



Project FORTH REPLACEMENT CROSSING

Document title

# **CONSTRUCTION NOISE MONITORING REPORT: MAY 2015**

01	07/07/2015	Comments addressed	SWR	LME	LSN
00	15/06/15	First Revision	SWR	LME	SSN
Rev	Rev. Date	Purpose of revision	Made	Checked	Approved

Document status

# FOR REVIEW

Made by: Steven Westwater	Checked By: Lindsay McIntyre		
Initials: SWR	Initials: LME		
Document number		Rev	
REP-00233		01	
This degree at it is intellectual preparate of ECDC Construction IV Convince distribution usage and information on contents			

This document is intellectual property of FCBC Construction JV. Copying, distribution, usage, and information on contents of this are forbidden unless explicitly authorized.



#### **Contents**

- 1. Introduction
- 2. Noise Monitoring Locations
- 3. Noise Monitoring Results



#### 1 Introduction

- 1.1 Monitoring of construction noise is being undertaken by FCBC during the construction of the new Forth Crossing and the associated road network. This report covers the month of May 2015. The objective of this report is to detail the monitoring that was undertaken across the site during this reporting period and to present the construction noise monitoring results.
- 1.2 Monitoring of construction noise has been undertaken in accordance with the Code of Construction Practice (CoCP) and the Noise and Vibration Management Plan (NVMP).



# 2 Noise Monitoring Locations

- 2.1 During May 2015, construction noise was monitored using permanent, continuous noise monitoring devices (01 db DUOs) at locations listed in Table 1. These monitors were installed during November and December 2011, with additional monitors installed at Scotstoun Park (Arup's Office) and Newton during March 2012, a further sound level meter was installed at Whinny Hill during March 2012.
- 2.2 Weather stations accompany the noise monitors at Echline Field, Tigh-Na-Grian, Clufflat Brae, Dundas Home Farm, Butlaw Fisheries, Linn Mill and Whinny Hill.
- 2.3 Various construction works were undertaken across the site during May 2015. Table 1 outlines the main construction activities in the location of each monitor.



# **Table 1: Monitoring Locations**

Ref.	Monitoring Location	Crossing or Network	Main Construction Activities During May 2015	
M1	Whinny Hill	Network	<ul> <li>Rock Trimming/Breaking/Crushing</li> <li>Earth Works/Fill Placement</li> <li>New Ferrytoll Road</li> <li>FT03 &amp; FT04 deck works</li> <li>FT09 works</li> <li>FT19 Retaining Wall</li> </ul>	
М3	Tigh-Na-Grian	Crossing	<ul> <li>Central Tower rebar, formwork, concreting works deck table installation works</li> <li>North Tower rebar, formwork, concreting works deck table installation works</li> <li>Pier N1 rebar formwork &amp; concrete works</li> <li>AVN works</li> </ul>	
M4	North Leg	Crossing	<ul> <li>Central Tower rebar, formwork, concreting works deck table installation works</li> <li>North Tower rebar, formwork, concreting works deck table installation works</li> <li>Pier N1 rebar formwork &amp; concrete works</li> </ul>	
M6	Port Edgar	Crossing	<ul> <li>Central Tower rebar, formwork, concreting works deck table installation works</li> <li>South Tower rebar, formwork, concreting works deck table installation works</li> <li>Pier S1 foundation work</li> <li>Pier S2 airlifting/Underwater concrete pour</li> <li>Pier S3 rebar, formwork &amp; concreting.</li> </ul>	
M7	Butlaw Fisheries	Crossing	<ul> <li>Assembling and fixing rebar and formwork works at Pier S3</li> <li>Concrete pouring at Pier S3</li> <li>Excavation/Cleaning at Pier S2/Underwater concrete pour</li> <li>Central Tower rebar, formwork, concreting works deck table installation works</li> <li>South Tower rebar, formwork, concreting works deck table installation works</li> </ul>	
M10	Inchgarvie Lodge	Crossing	<ul> <li>Launch – Painting works, snagging and bearing installation</li> <li>Assembling and fixing rebar and formwork works at Pier S3</li> <li>Concrete, rebar, formwork at Pier S3</li> <li>Excavation/Cleaning at Pier S2 Underwater concrete pour</li> <li>Central Tower rebar, formwork, concreting works deck table installation works</li> <li>South Tower rebar, formwork, concreting works deck table installation works.</li> </ul>	



I <del>r.</del>			
			Main carriageway earthworks
M11	Linn Mill	Network (close proximity to Crossing)	<ul> <li>Launch – Painting works, snagging and bearing installation</li> <li>No night time or Sunday construction in the vicinity</li> <li>Main carriageway earthworks</li> </ul>
M13	Clufflat Brae	Crossing / Network	<ul> <li>Launch – Painting works, snagging and bearing installation</li> <li>No night time or Sunday construction in the vicinity</li> <li>Main carriageway earthworks</li> </ul>
M14	Springfield	Network	<ul> <li>Launch – Painting works, snagging and bearing installation</li> <li>No night time or Sunday construction in the vicinity</li> <li>Main carriageway earthworks</li> </ul>
M15	Echline	Network	<ul> <li>Launch – Painting works, snagging and bearing installation</li> <li>No night time or Sunday construction in the vicinity</li> <li>Main carriageway earthworks</li> </ul>
M16	Scotstoun	Network	<ul> <li>Access and bus link surfacing works</li> <li>Footpath works</li> <li>Drainage works</li> <li>Utility works</li> <li>B800 North road works including bridge works (these works are directly in the location of the meter which now sits within the construction boundary).</li> <li>Soil stripping on mainline</li> </ul>
M17	Dundas Home Farm	Network	Utility works B800 South road works including bridge works etc Soil stripping on mainline
M18	Newton	Network	No works



## 3 Noise Monitoring Results

### Overview

- **3.1** Noise monitoring results are presented in graphs (**Appendix A**) using the template provided in the *Construction Noise Monitoring Information Note* (www.transportscotland.gov.uk).
- **3.2** With regard to the noise monitoring graphs, the following should be noted:
  - All locations are considered as either 'Main Crossing' or 'Network Connections', as set out in **Table 1**.
  - Main Crossing works are undertaken during the day, evening and night time periods. Network connection works are undertaken during the daytime only.
  - Linn Mill is considered as a network location which has the potential to receive noise from the marine works near the south shore. As a result, evening and night time data has been included for this location.
  - Noise data for day, evening and night on which no construction works were conducted have been excluded from the monthly average results presented in the graph. L<sub>AFmax</sub> exceedances during these periods would have been caused by non-construction related factors and do not require investigation. Noise results (L<sub>Aeq</sub> and L<sub>AFmax</sub>) for any day, evening and night on which no construction works have been conducted have been presented in the graphs in greyed out areas.
  - An average for Sunday construction noise data has been included where applicable; in locations where no Sunday works were conducted no average is shown.
  - As set out in the CoCP, the assessment time for evening, nights and Sunday daytime is in one hour periods. To present the construction noise results for these periods, therefore, the maximum L<sub>AFmax</sub> (fast time response) and maximum L<sub>Aeq</sub> within the overall evening/night time period has been taken. It should be noted, therefore, that the average shown for these periods is an average of only the highest L<sub>Aeq</sub> results.
  - It has been indicated on the graphs where noise data is missing for day, evening or night during which construction works were conducted. Results for the North leg are unavailable due to inaccessibility of the monitor location in May 2015.

#### Results



- 3.3 Results demonstrate that the monthly average total construction noise results for daytime are within the threshold levels for all monitoring locations during May 2015, with the exception of Scotstoun. For the night time periods, there were exceedances at locations; Butlaw Fisheries and Inchgarvie. There are no exceedances of Sunday averages.
- 3.4 The rises in daytime exceedances at Scotstoun are likely to be due to the very close proximity of construction to the monitoring location. The works are very similar to previous works in the vicinity and construction noise levels at residential receptors were unlikely to be higher than before. No residential complaints were received from any of the residents in the location of the works during this period.
- 3.5 The exceedances noted are not thought to have been caused by increased noise levels due to construction. Each of the exceedances with the exception of the daytime averages at Scotstoun, were found to be affected by increased noise levels due to periods of adverse weather, traffic, residential noise and birds. Audio demonstrates that the increased levels were caused by waves and birds at Butlaw Fisheries and birds and resident activity at Inchgarvie, strong wind also contributed to increased levels at these locations. With regard to the averages reported for evening and night time periods, it should be noted that these averages are based only on the highest L<sub>Aeq</sub> levels for 1 hour periods which can affect the averages.
- 3.6 During May 2015, some exceedances of the maximum noise thresholds occurred. Each exceedance of the threshold was investigated using triggered audio recordings, records of construction works (i.e. site programmes and diaries and daily marine reports) and analysis of weather station data, where required. A Noise and Vibration Investigative Report (NVIR) spread sheet has been produced detailing the results of the investigation for each exceedance. No exceedances this month are due to construction works.
- 3.7 The majority of exceedances at all locations were caused by factors including periods of localised noises at nearby properties such as traffic, residential noise and birds. At some locations, notably Scotstoun and Echline, existing traffic noise had an effect on maximum noise levels during the period covered in this report. Butlaw Fisheries also records a high number of waves against the shore during times of bad weather and high tides.
- **3.8** A summary of the findings for exceedances occurring at each of the locations can be found in Table 2.


#### **Table 2: Summary of Exceedances at Monitoring Locations**





Monitoring Location	Summary of Exceedance Details
Butlaw Fisheries	During May the maximum noise threshold was exceeded on 41 occasions (9 day time, 3 evening and 29 night time). No exceedances were related to construction works. Exceedances were attributed to non-construction factors notably birds, wind and waves.
Clufflat Brae	During May the maximum noise threshold was exceeded on 63 occasions (16 daytime, 18 evening and 29 night time). No exceedances were found to be due to construction works. Exceedances were found to be largely due to birds, dogs and residential activity.
Inchgarvie Lodge	During May the maximum noise threshold was exceeded on 82 occasions (24 day time, 27 evening and 31 night time). No exceedances were attributed to construction works. Investigations found residents at the property and bird song to be the main contributing factors to the exceedances in this location. Other factors included vehicles and monitor maintenance.
Linn Mill	During May the maximum noise threshold was exceeded on 70 occasions (15 daytime, 24 evening and 31 night time). The majority of exceedances at this location were largely due to residents, wind and bird songs. All the night time exceedances were attributed to bird song.
Tigh-Na-Grian	During May the maximum noise threshold was exceeded on 39 occasions (10 daytime, 0 evening and 29 night time). Exceedances were due to non-construction factors, notably wind and birds. Residential noise was also picked-up during the daytime.
Dundas Home Farm	During May the maximum noise threshold was exceeded on 27 occasions. These exceedances were not caused by the works. The exceedances were due to monitor maintenance, kids playing and birds.
Echline	During May the maximum noise threshold was exceeded on 30 occasions. No exceedances at this location were due to construction activities. All exceedances were attributed to vehicles passing by on the adjacent roads.
Springfield	During May the maximum noise threshold was exceeded on 20 occasions. These exceedances were due to, local residents and their pets (dogs). The monitor is situated within a garden with a dog next door.
Scotstoun	During May the maximum noise threshold was exceeded on 31 occasions. The majority of these exceedances were due to construction; this is due to the location of the current meter being in the immediate vicinity of on-going works on the B800. Many exceedances were attributed to vehicles passing (including Sundays) by on the adjacent road
Whinny Hill	During May the maximum noise threshold was exceeded on 9 occasions. Exceedances were not due to construction activities. Exceedances were due to a range of factors such as residents, dogs and birds.
North Leg	No data is reported in this report due to access to monitor being restricted due to limited accessibility to this device. Wireless operation is unavailable and awaiting repair which is scheduled for June 2015.
Port Edgar	Recordings taken for data purposes





## **APPENDIX A**

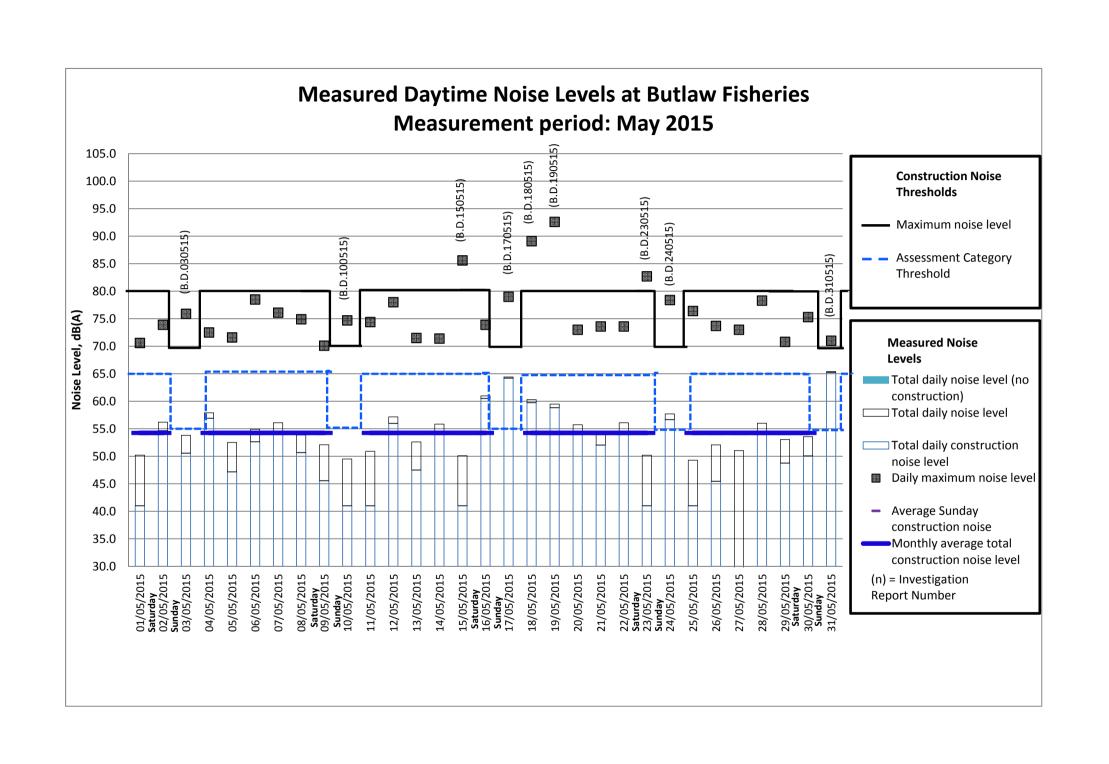


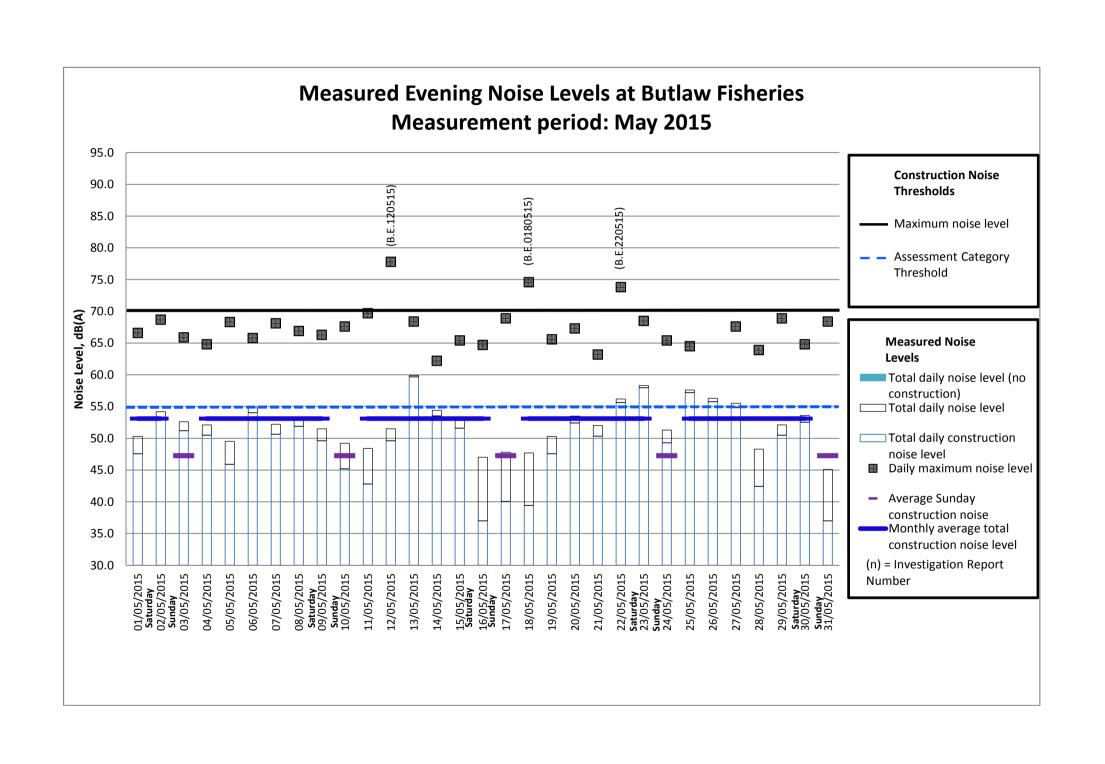


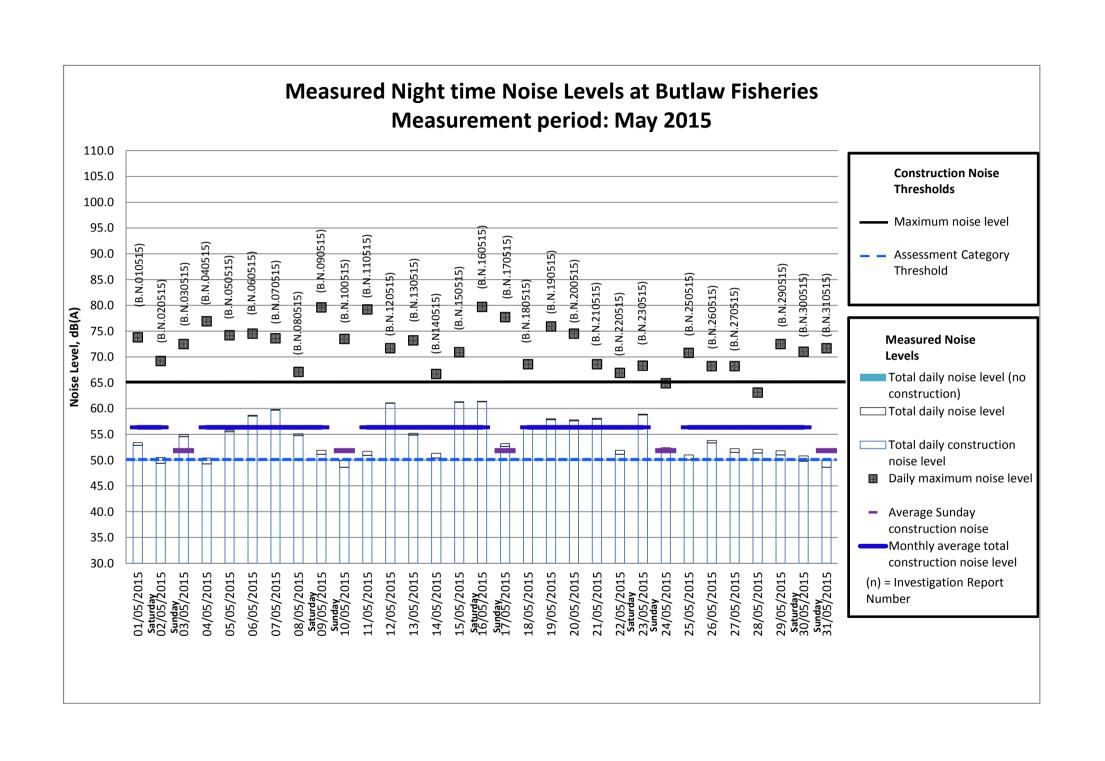


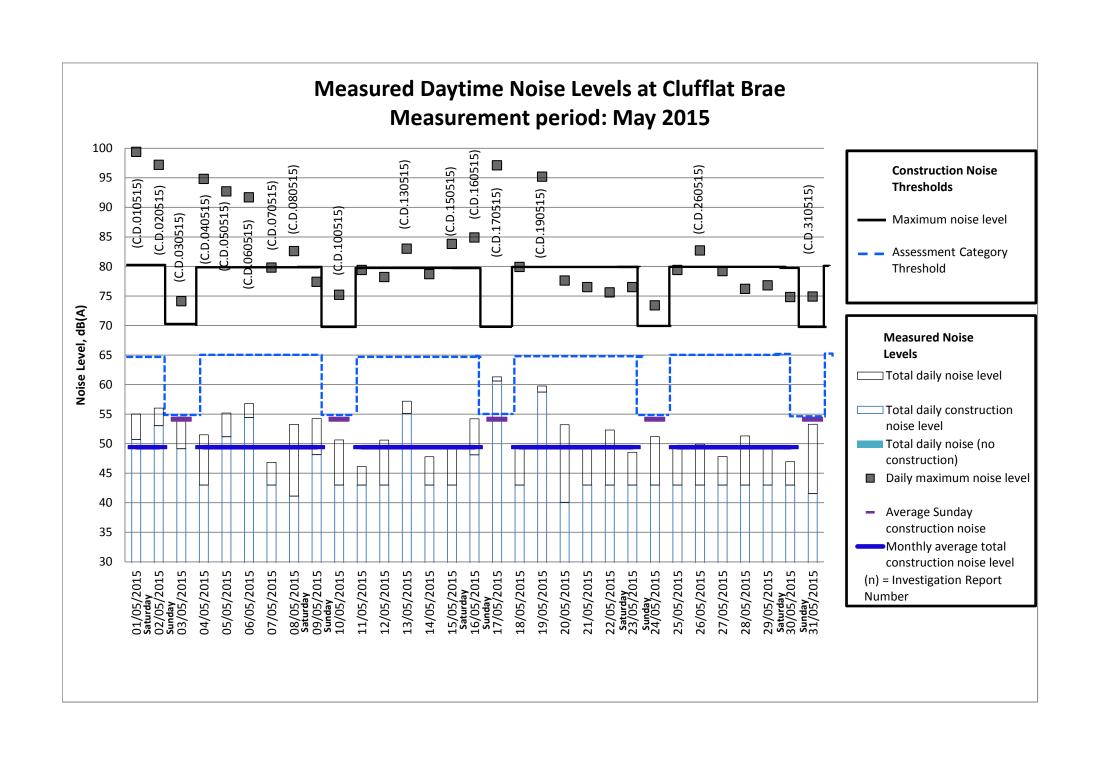

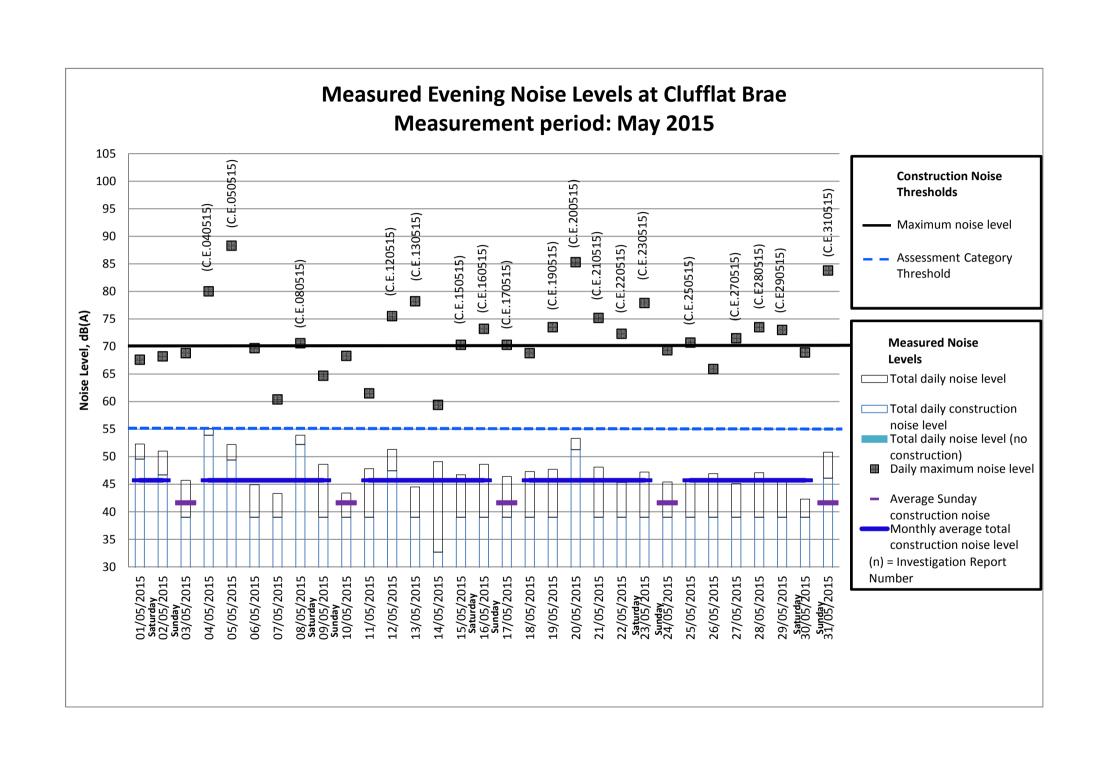


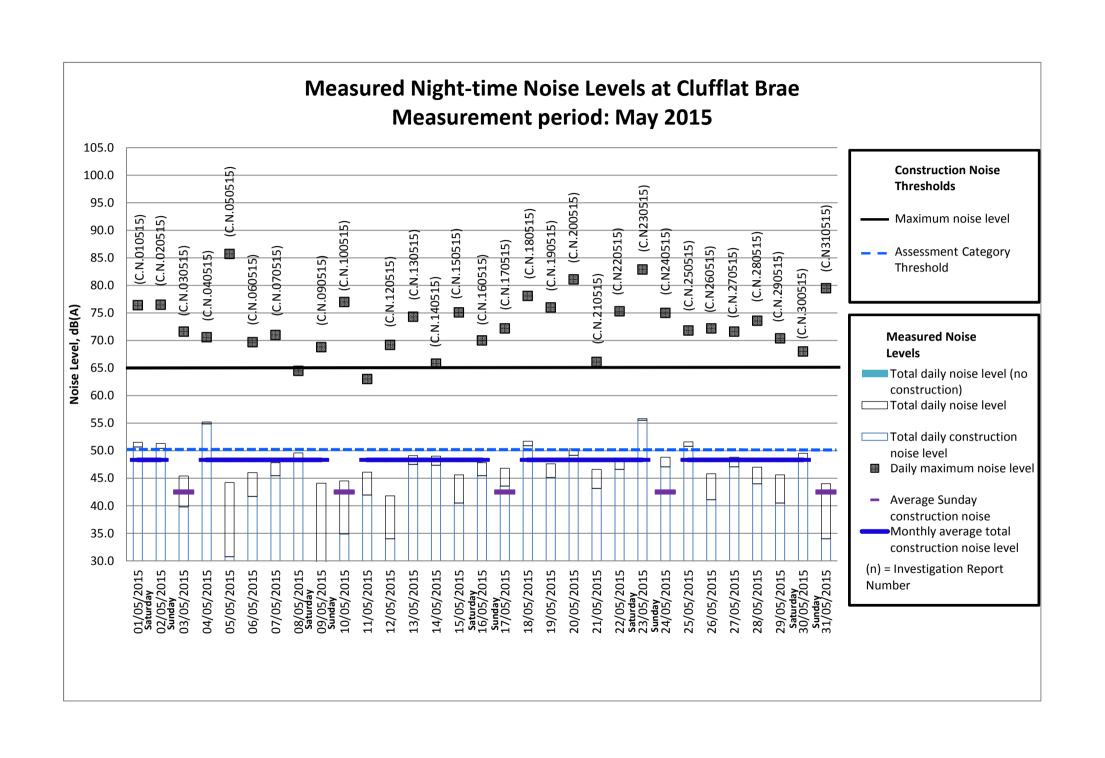




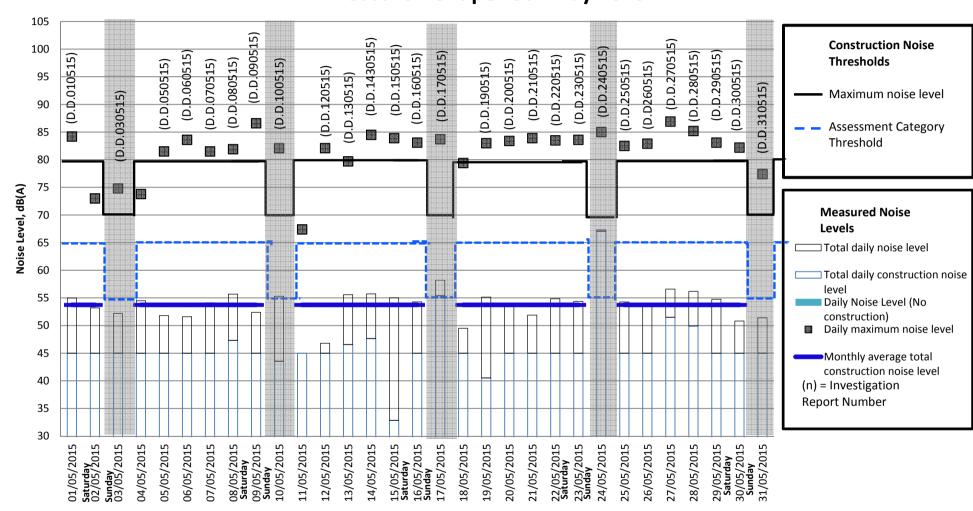



**Note:** The grey areas of the chart represent days on which no construction works have been conducted. The Sunday average has not been included as no Sunday works have been conducted at this location.

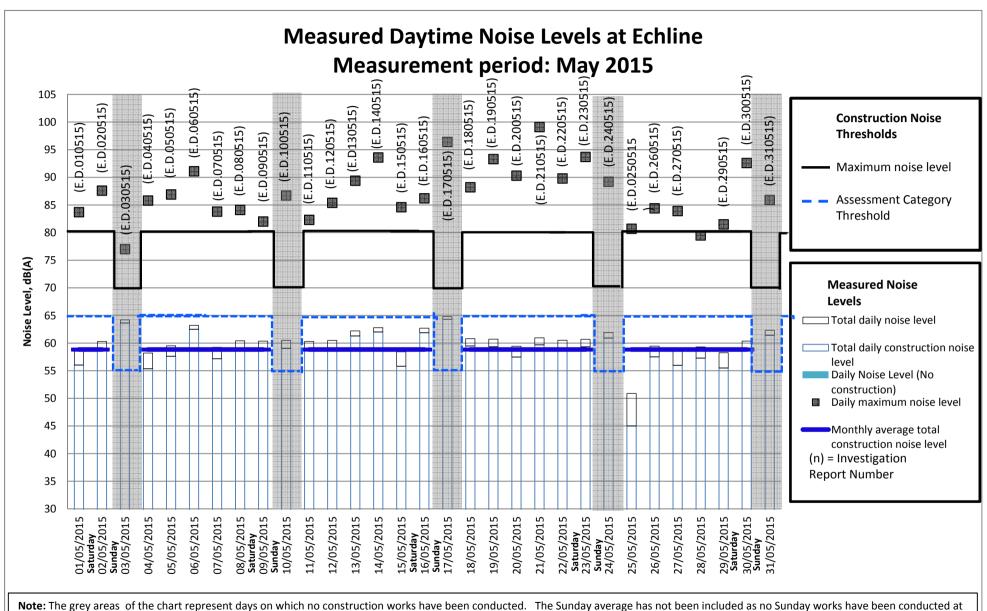



**Note:** The grey areas of the chart represent days on which no construction works have been conducted. The Sunday average has not been included as no Sunday works have been conducted at this location.

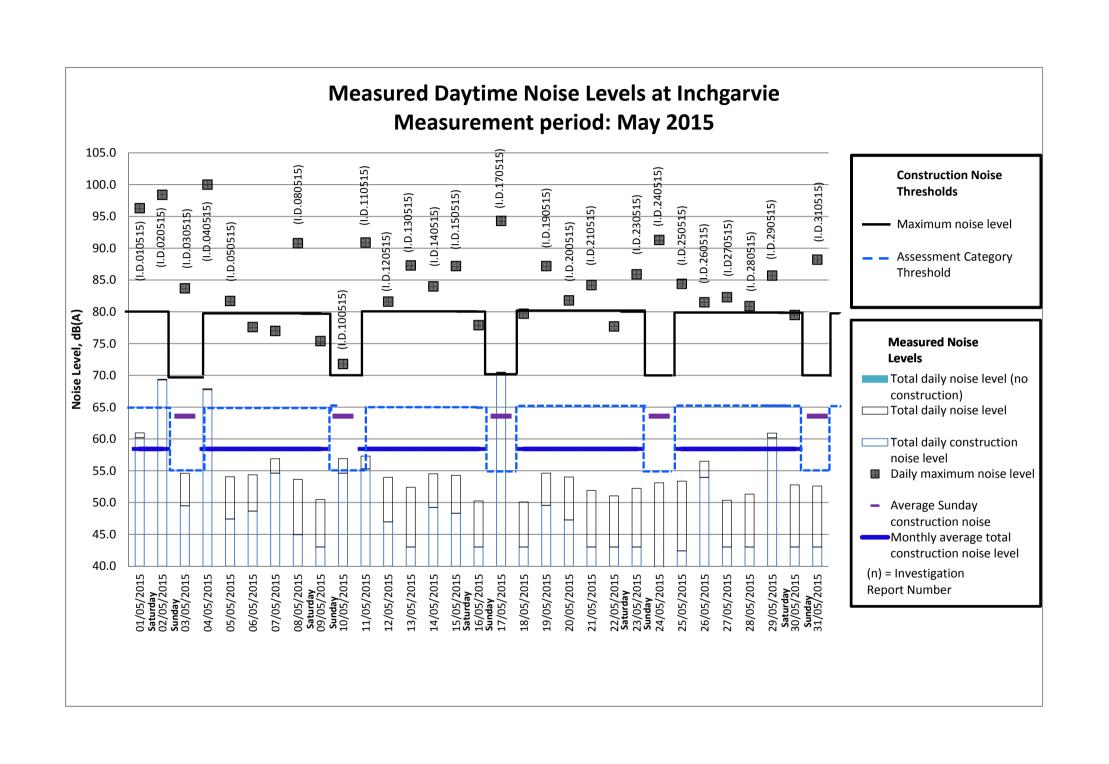


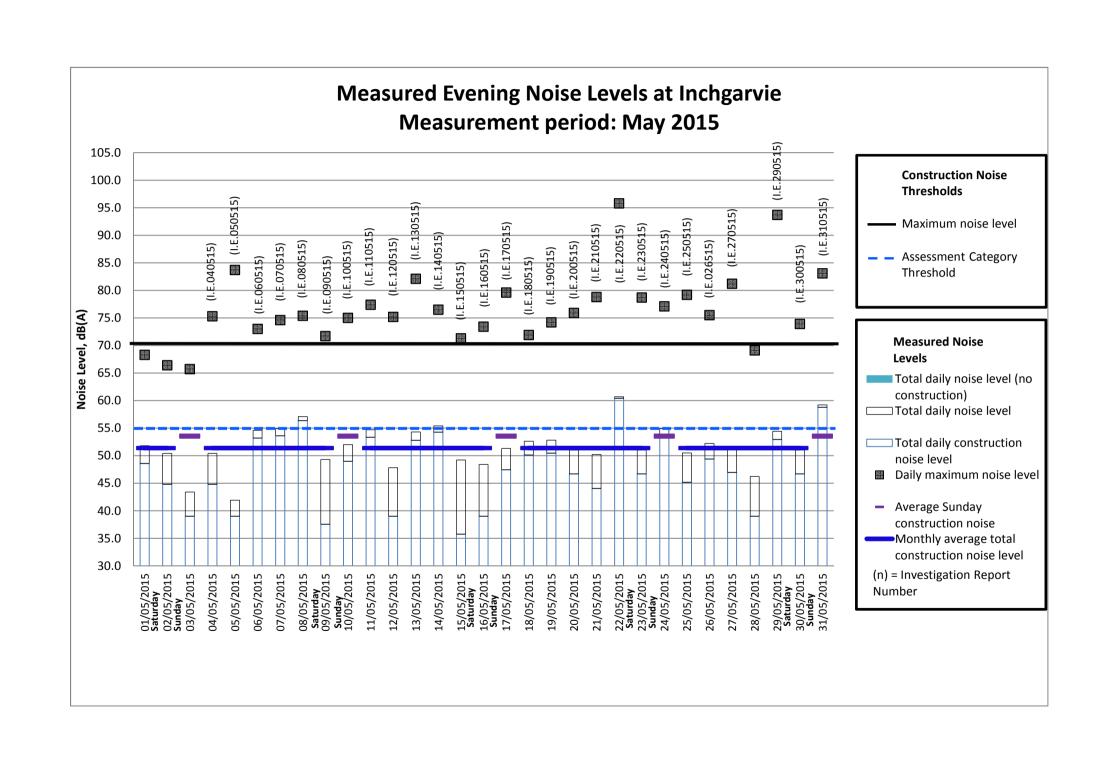


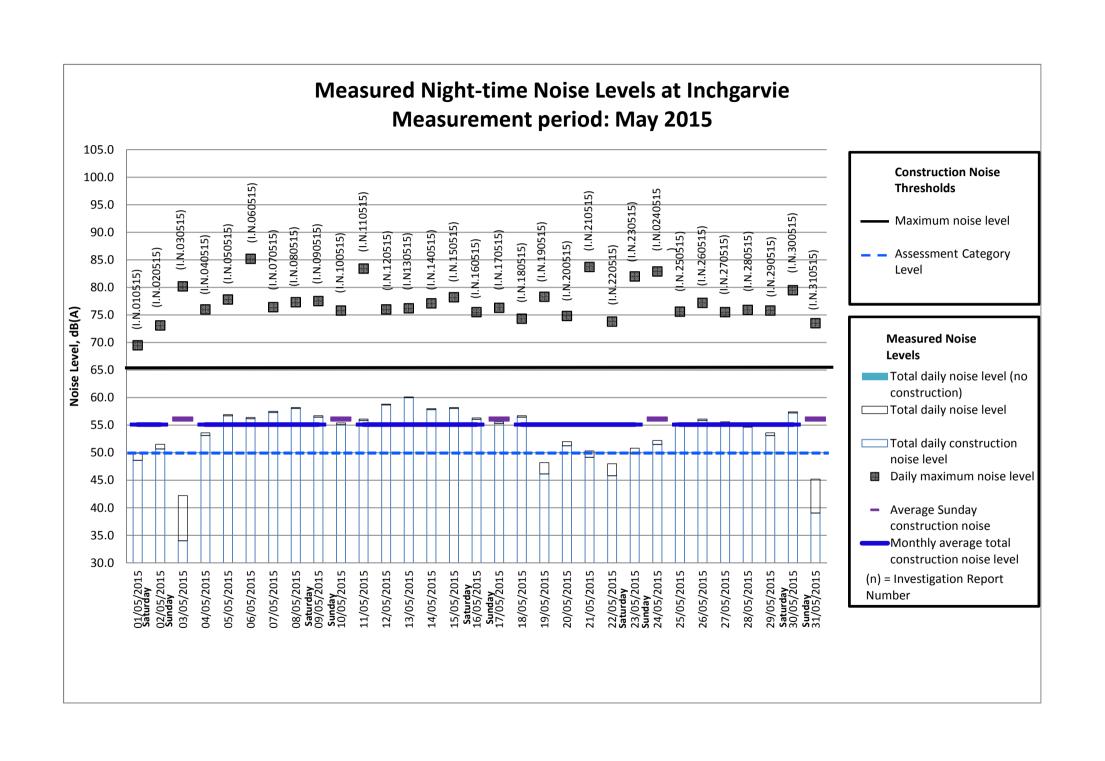


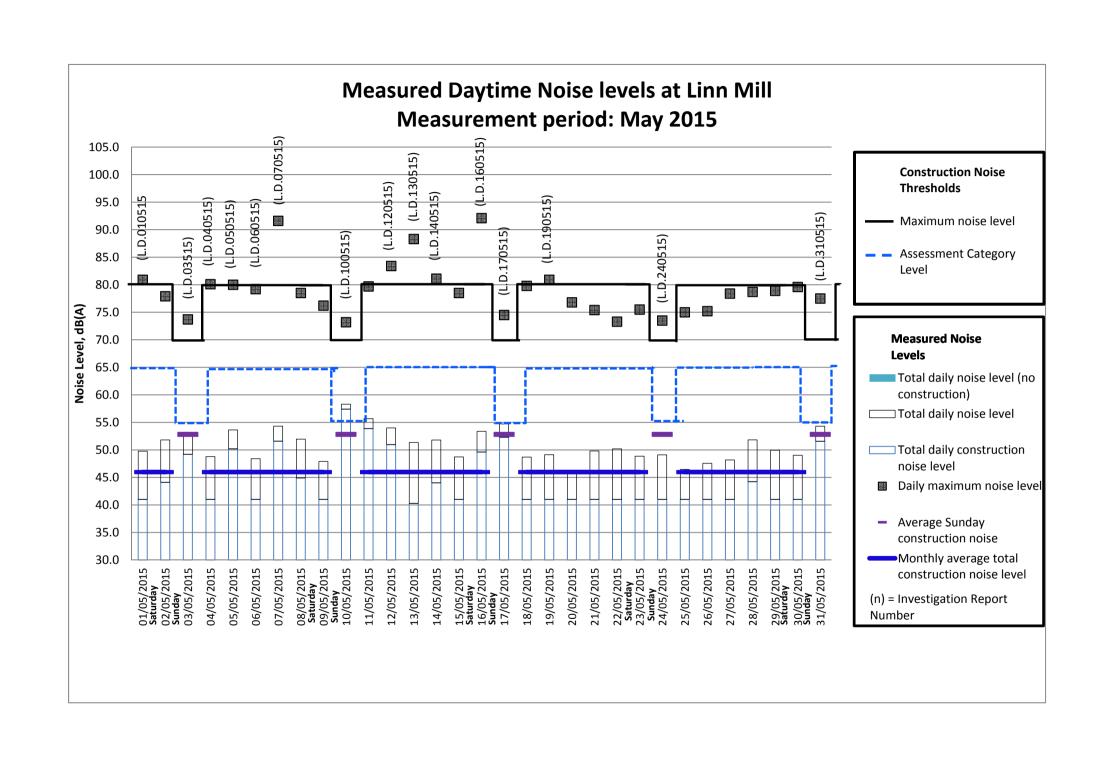


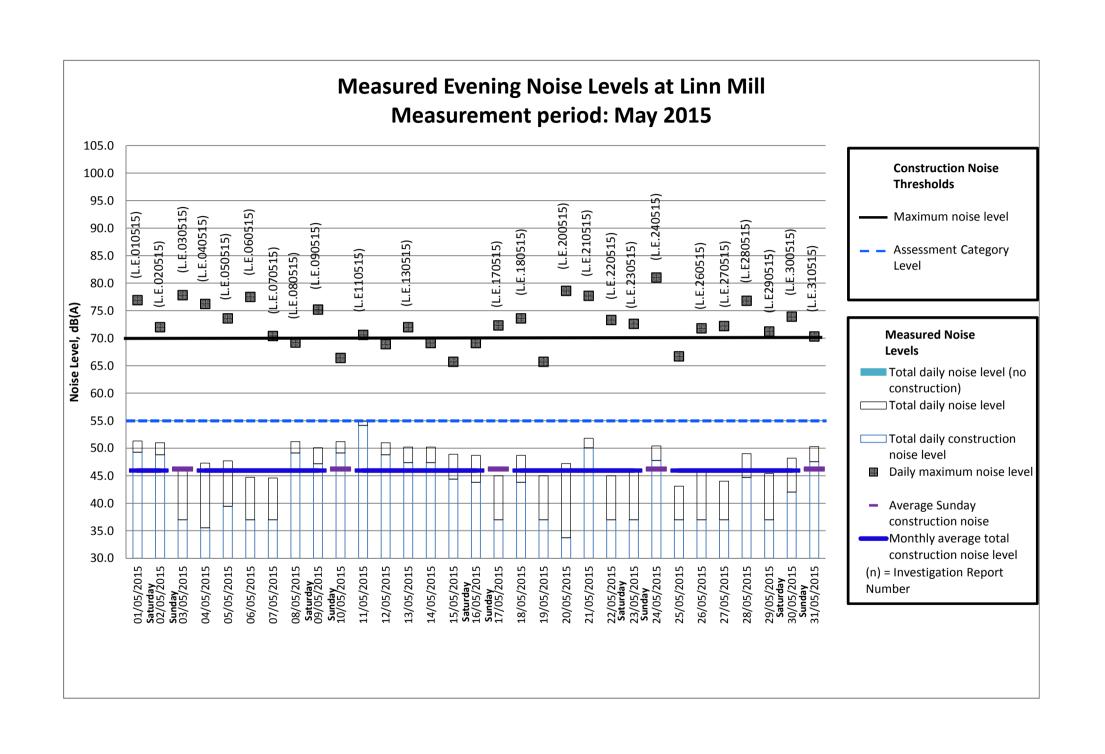


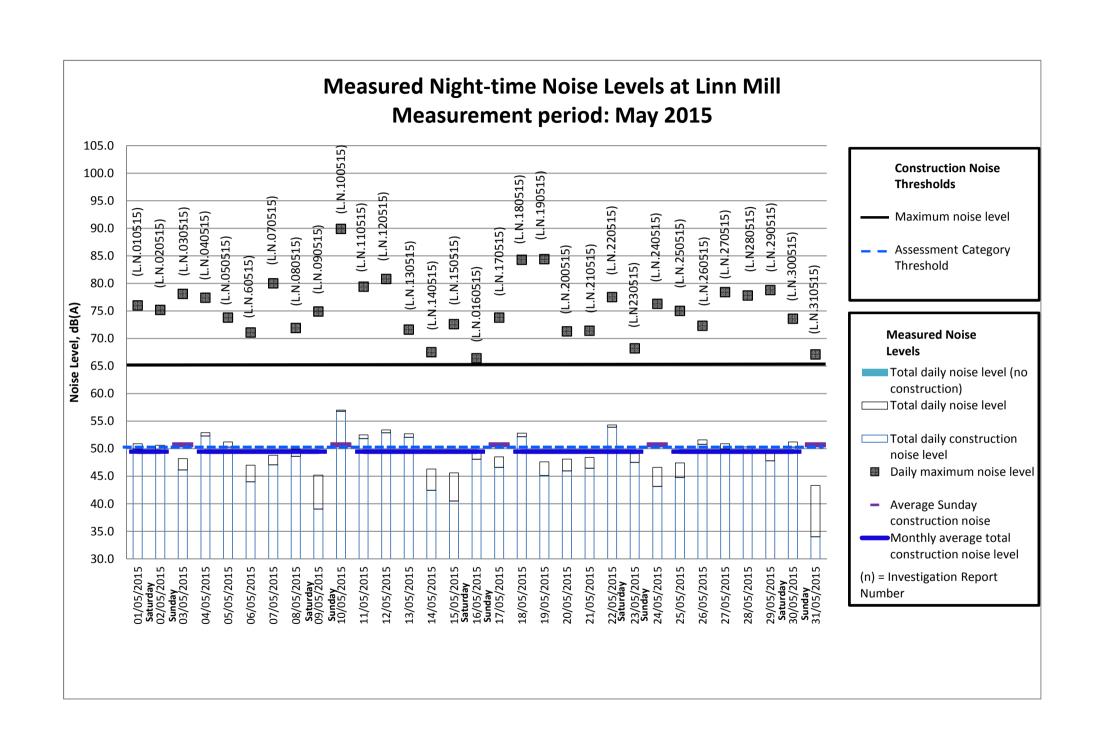


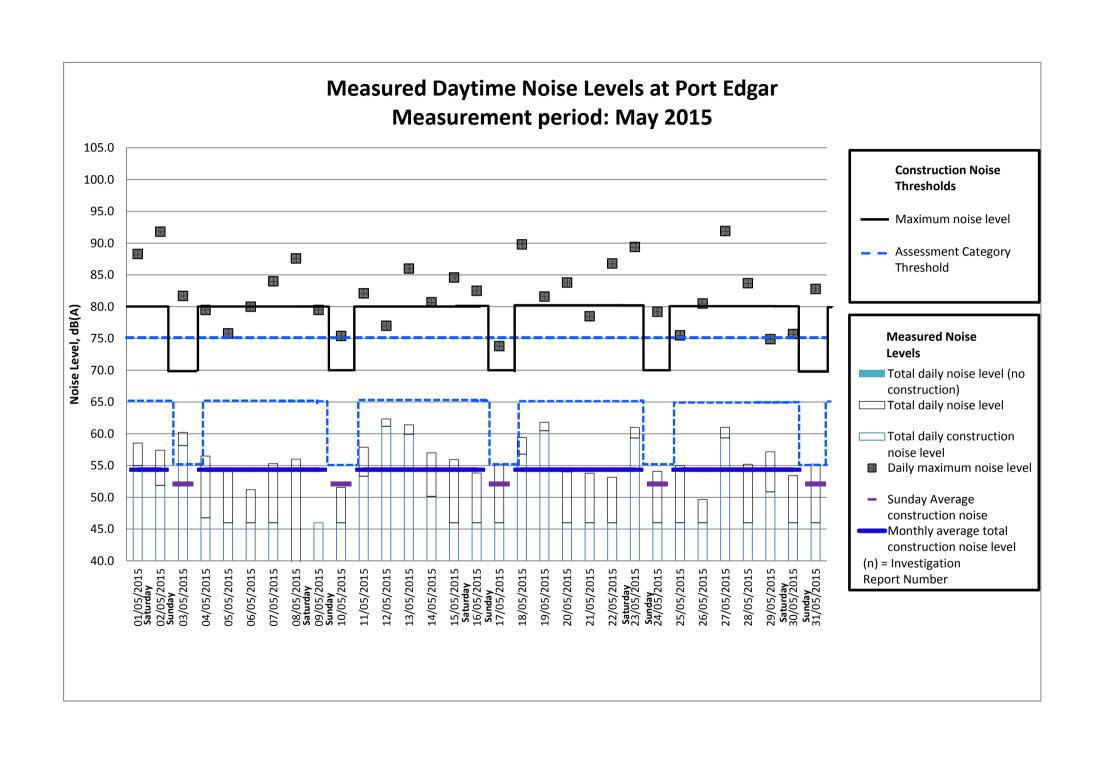

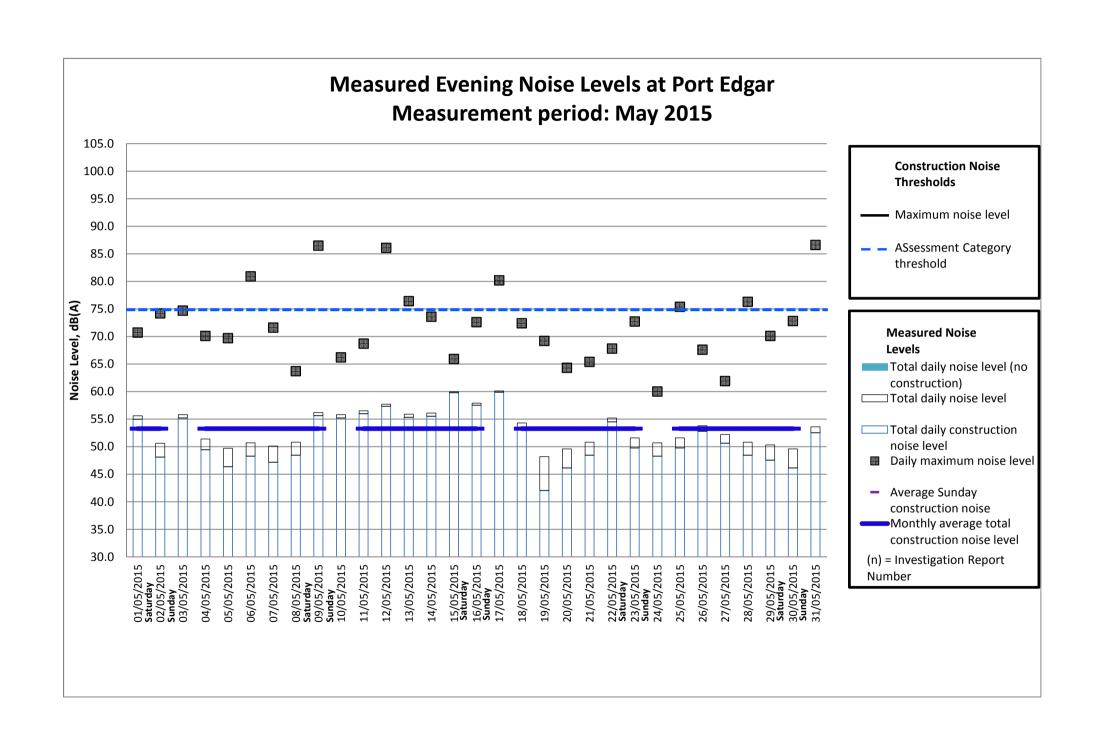


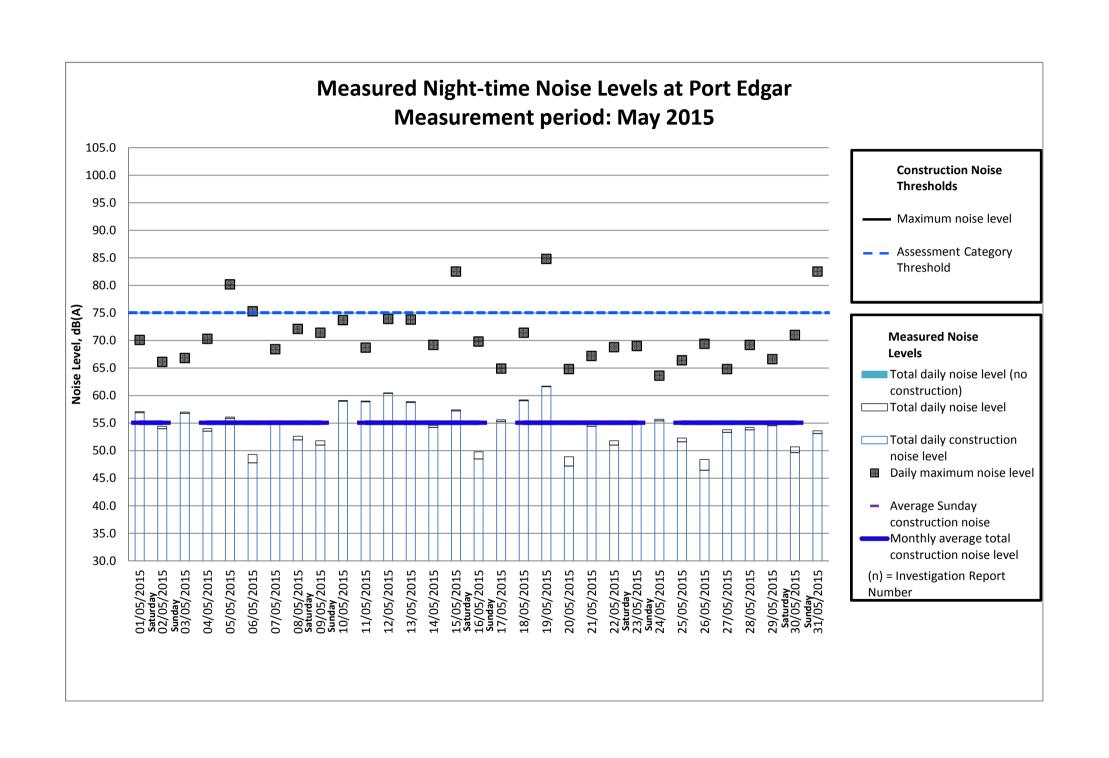


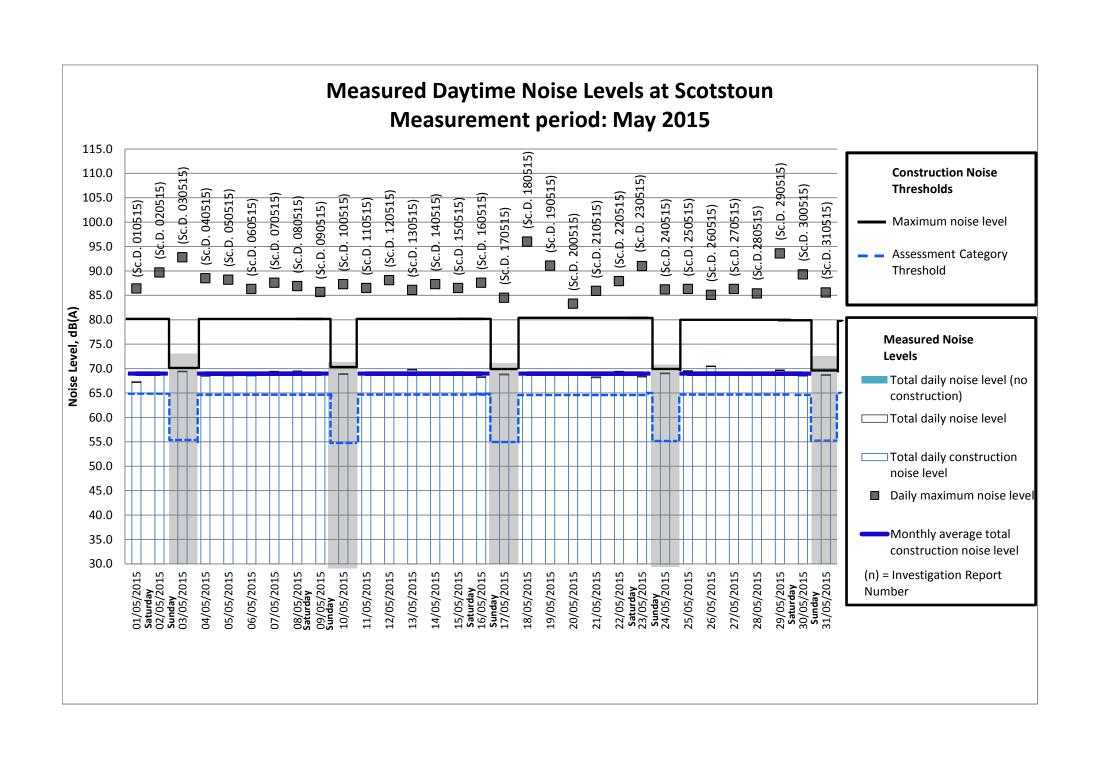


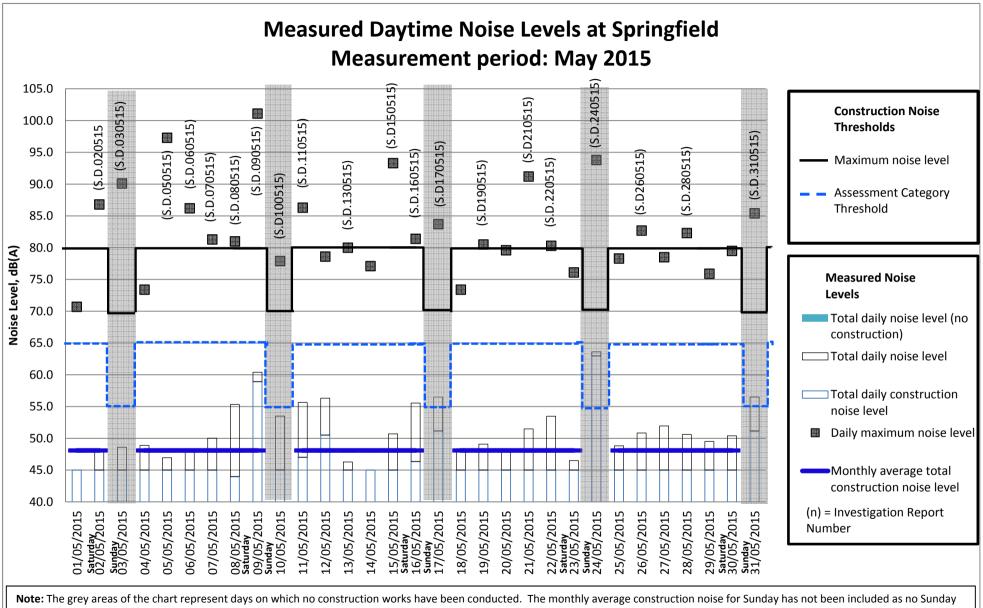


works have been conducted at this location. Data is missing for 19/05/13 due to device error.

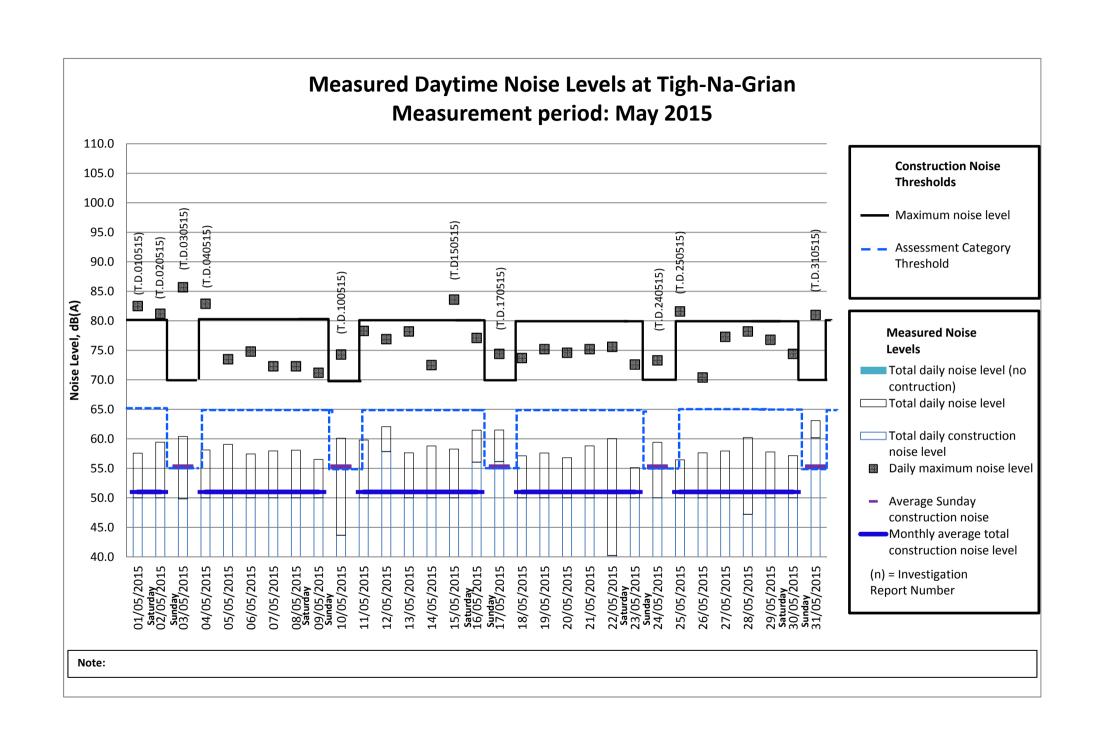

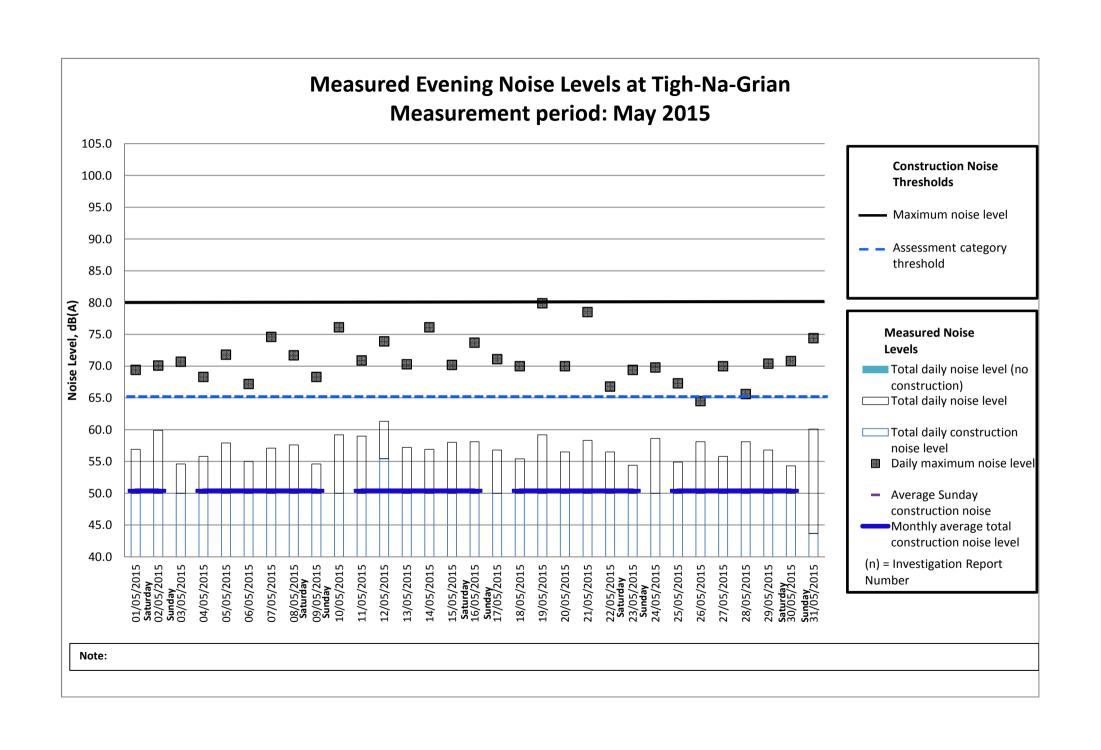

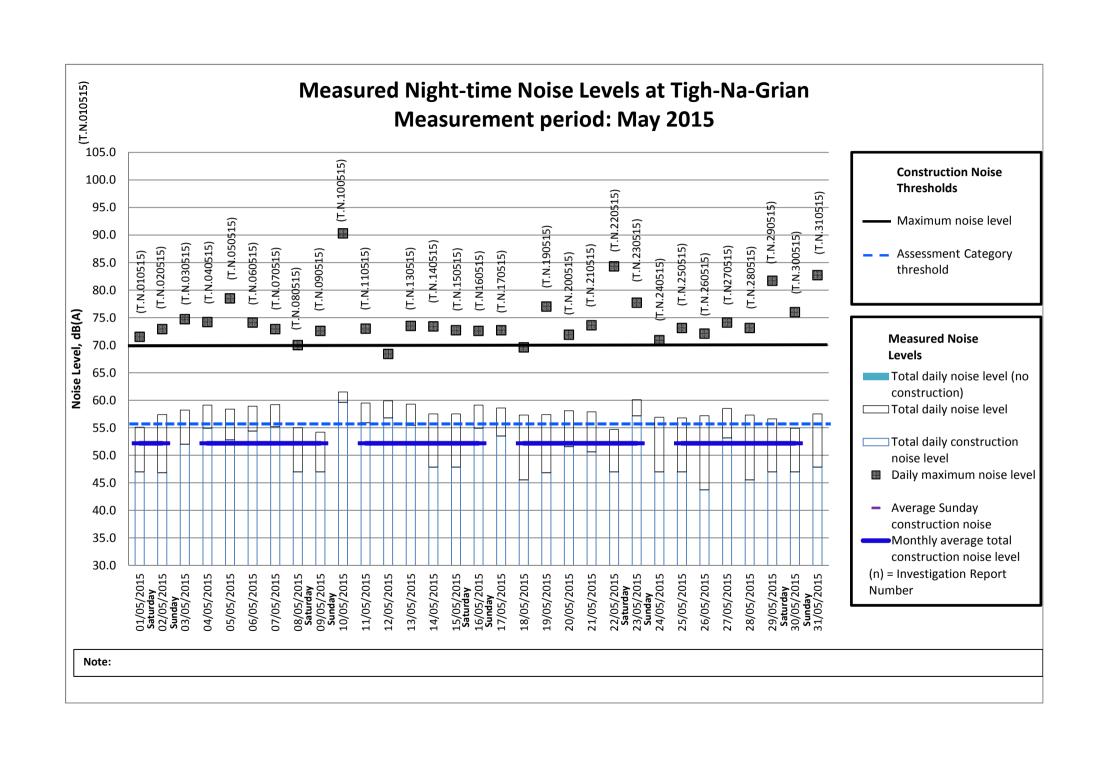

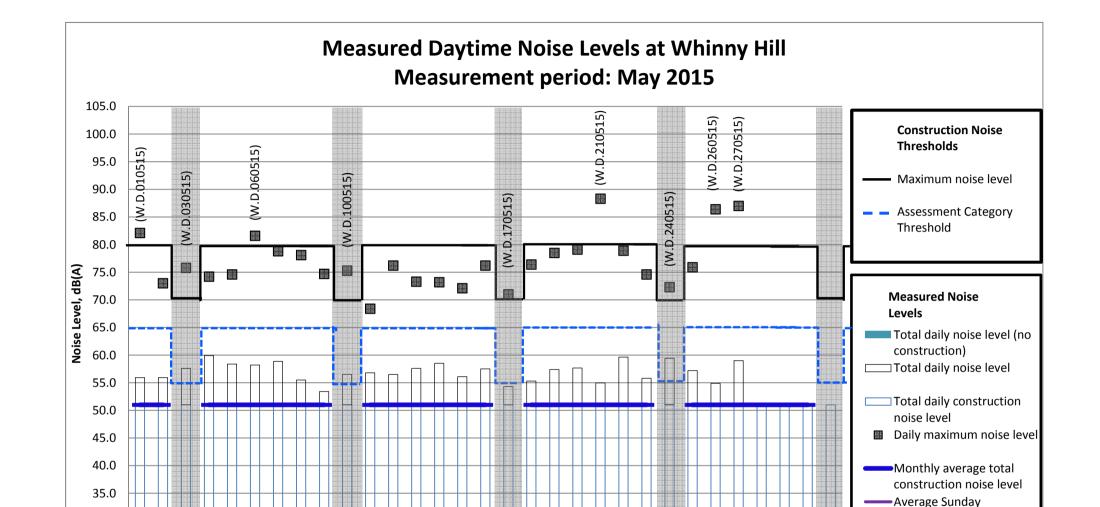

construction noise

(n) = Investigation Report

Number

29/05/2015 Saturday 30/05/2015 Sunday 31/05/2015

Note: The grey areas of the chart represent days on which no construction works have been conducted. There is no data from 27/04/2015 - 31/04/2015 due to monitor maintance

19/05/2015 20/05/2015 21/05/2015

18/05/2015

15/05/2015 saturday 16/05/2015 sunday 17/05/2015 22/05/2015 Saturday 23/05/2015 Sunday 24/05/2015

26/05/2015 27/05/2015 28/05/2015

25/05/2015

08/05/2015 Saturday 09/05/2015 Sunday 10/05/2015

12/05/2015 13/05/2015 14/05/2015

11/05/2015

30.0

01/05/2015 Saturday 02/05/2015 Sunday 03/05/2015

05/05/2015 06/05/2015 07/05/2015

04/05/2015