

Contractor



Project FORTH REPLACEMENT CROSSING

Document title

# **CONSTRUCTION NOISE MONITORING REPORT: AUGUST 2017**

00	08/09/2017	First Revision	SWR	DCK	DCK
Rev	Rev. Date	Purpose of revision	Made	Checked	Approved

Document status

**REP-00341** 

# FOR REVIEW

Made by: Steven Westwater	Checked By: David Clark	
Initials: SWR	Initials: DCK	
Document number		

00

This document is intellectual property of FCBC Construction JV. Copying, distribution, usage, and information on contents of this are forbidden unless explicitly authorized.



## **Contents**

- 1. Introduction
- 2. Noise Monitoring Locations
- 3. Noise Monitoring Results



#### 1 Introduction

- 1.1 Monitoring of construction noise is being undertaken by FCBC during the construction of the new Forth Crossing and the associated road network. This report covers the month of August 2017. The objective of this report is to detail the monitoring that was undertaken across the site during this reporting period and to present the construction noise monitoring results.
- **1.2** Monitoring of construction noise has been undertaken in accordance with the Code of Construction Practice (CoCP) and the Noise and Vibration Management Plan (NVMP).



# 2 Noise Monitoring Locations

- 2.1 During August 2017, construction noise was monitored using permanent, continuous noise monitoring devices (01db DUOs) at locations listed in **Table 1**. These monitors were installed during November and December 2011, with additional monitors installed at Scotstoun Park (Arup's Office) and Newton during March 2012, a further sound level meter was installed at Whinny Hill during April 2012.
- **2.2** Weather stations accompany the noise monitors at Linn Mill and Whinny Hill.
- 2.3 Various construction works were undertaken across the site during August 2017. **Table 1** outlines the main construction activities in the location of each monitor.



# **Table 1: Monitoring Locations**

Ref.	Monitoring Location	Crossing or Network	Main Construction Activities During August 2017
M1	Whinny Hill	Network	Earth Works/Fill Placement     Main carriageway roadworks
M3	Tigh-Na-Grian	Crossing	<ul> <li>Central Tower stay cable installation works</li> <li>North Tower stay cable installation works,</li> <li>Bridge Deck works</li> </ul>
M7	Butlaw Fisheries	Crossing	<ul> <li>Central Tower stay cable installation works</li> <li>Deck surfacing</li> <li>Wind shield installation</li> <li>South Tower stay cable installation works</li> <li>Bridge deck works</li> </ul>
M10	Inchgarvie Lodge	Crossing	<ul> <li>Minor main carriageway works</li> <li>SUDS detention basin works</li> <li>Waterproofing on deck</li> <li>Deck surfacing</li> <li>Wind shield installation</li> <li>South Tower stay cable installation works</li> <li>Bridge deck works</li> <li>South abutment works</li> <li>Society Road Works</li> </ul>
M11	Linn Mill	Network (close proximity to Crossing)	<ul> <li>Minor main carriageway works</li> <li>Waterproofing on deck</li> <li>Deck surfacing</li> <li>Wind shield installation</li> <li>South Tower stay cable installation works</li> <li>Bridge deck works</li> <li>South abutment works</li> <li>Society Road Works</li> </ul>
M13	Clufflat Brae	Crossing / Network	<ul> <li>Minor main carriageway works</li> <li>SUDS detention basin works</li> <li>Waterproofing on deck</li> <li>Deck surfacing</li> <li>Wind shield installation</li> <li>South Tower stay cable installation works</li> <li>Bridge deck works</li> <li>South abutment works</li> <li>Cycle / footpath work</li> <li>Society Road Works</li> </ul>
M14	Springfield	Network	<ul><li>Minor main carriageway works</li><li>SUDS detention basin works</li><li>South abutment works</li></ul>



DRAGADOS	AN	MERICAN BRIDGE INTERNATIONAL
HOCHTIE	F	MORRISON CONSTRUCTION

M15	Echline	Network	South Abutment works     Cycle/footway works
M16	Scotstoun	Network	Minor main carriageway roadworks
M17	Dundas Home Farm	Network	Minor main carriageway roadworks
M18	Newton	Network	Outwith works area



## Noise Monitoring Results

#### Overview

- **2.4** Noise monitoring results are presented in graphs (**Appendix A**) using the template provided in the *Construction Noise Monitoring Information Note* (www.transportscotland.gov.uk).
- **2.5** With regard to the noise monitoring graphs, the following should be noted:
- All locations are considered as either 'Main Crossing' or 'Network Connections', as set out in **Table 1**.
- Main Crossing works are undertaken during the day, evening and night time periods. Network connection works are generally undertaken during the daytime only.
- Linn Mill is considered as a network location which has the potential to receive noise from the marine works near the south shore. As a result, evening and night time data has been included for this location.
- Noise data for day, evening and night on which no construction works were conducted have been excluded from the monthly average results presented in the graph. L<sub>AFmax</sub> exceedances during these periods would have been caused by non-construction related factors and do not require investigation. Noise results (L<sub>Aeq</sub> and L<sub>AFmax</sub>) for any day, evening and night on which no construction works have been conducted have been presented in the graphs as greyed out areas.
- An average for Sunday construction noise data has been included where applicable; in locations where no Sunday works were conducted no average is shown.
- As set out in the CoCP, the assessment time for evening, night and Sunday daytime is in one hour periods. To present the construction noise results for these periods, therefore, the maximum  $L_{AFmax}$  (fast time response) and maximum  $L_{Aeq}$  within the overall evening/night time period has been taken. It should be noted, therefore, that the average shown for these periods is an average of only the highest  $L_{Aeq}$  results.



### Results

- 2.6 Results demonstrate that the monthly average total of construction noise results for daytime and evening are within the threshold levels for all monitoring locations during August 2017. For night time periods, there were exceedances of monthly average at Butlaw. There was exceedance of Sunday average for night time at Tigh-Na-Grian.
- 2.7 Most exceedances noted were not caused by construction activities. Each exceedance was found to be influenced by increased noise levels due to periods of weather, traffic, residential noise or birdsong. Audio recordings demonstrate that the increased levels were caused by sea waves and birdsong at Butlaw Fisheries and birdsong at Tigh-Na-Grian. With regard to the averages reported for night-time periods, it should be noted that these averages are based only on the highest LAeq levels for 1 hour periods which can affect the averages.
- 2.8 Each exceedance of the threshold was investigated using triggered audio recordings, records of construction works (i.e. site programmes, diaries and daily marine reports) and analysis of weather station data, where required. A Noise and Vibration Investigative Report (NVIR) spread sheet has been produced detailing the results of the investigation for each construction exceedance. There were some exceedances this month that were due to construction work.
- **2.9** There were no construction related exceedances caused during the period.
- **2.10** A summary of the findings for exceedances occurring at each of the locations can be found in Table 2.

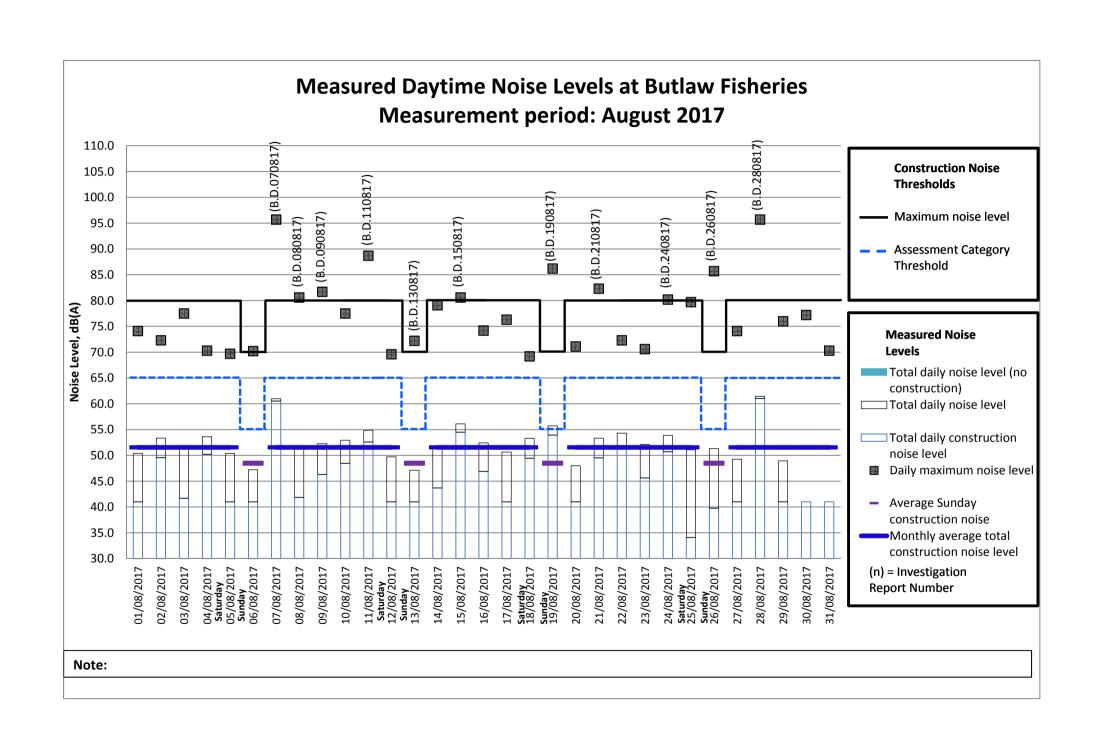



**Table 2: Summary of Exceedances at Monitoring Locations** 


Monitoring Location	Summary of Exceedance Details
Butlaw Fisheries	During August the maximum noise threshold was exceeded on 45 occasions (11 day time, 9 evening and 25 night time). Most exceedances were attributed to non-construction factors, notably birdsong and waves. There were no instances of construction noise exceeding the threshold.
Clufflat Brae	During August the maximum noise threshold was exceeded on 22 occasions (6 daytime, 5 evening and 11 night time). Exceedances were mainly found to be due to birdsong and residents. There were no instances of construction noise exceeding the threshold.
Inchgarvie Lodge	During August the maximum noise threshold was exceeded on 50 occasions (19 day time, 13 evening and 18 night time). No exceedances were related to construction activity. Exceedances were mainly found to be due to birdsong and residents.
Linn Mill	During August the maximum noise threshold was exceeded on 48 occasions (7 daytime, 11 evening and 20 night time). No exceedances were related to construction activity. The majority of exceedances at this location were due to birdsong and residents.
Tigh-Na-Grian	During August the maximum noise threshold was exceeded on 57 occasions (19 daytime, 19 evening and 19 night time). No exceedances were related to construction activity. Exceedances were mainly due to birdsong and wind.
Dundas Home Farm	During August the maximum noise threshold was exceeded on 18 occasions. No exceedances were related to construction activity. The main exceedances were due to residents and birdsong.
Echline	During August the maximum noise threshold was exceeded on 31 occasions. Exceedances were attributed to vehicles passing by on the adjacent roads.
Springfield	During August the maximum noise threshold was exceeded on 17 occasions. These exceedances were due to local residents.
Scotstoun	During August the maximum noise threshold was exceeded on 30 occasions. These exceedances were attributed to general traffic noise on the adjacent road.
Whinny Hill	During August the maximum noise threshold was exceeded on 12 occasions during the daytime. No exceedances at this location were attributed to construction activities. Most exceedances were due to birdsong and residents
Newton	Recordings taken for data record purposes




## **APPENDIX A**




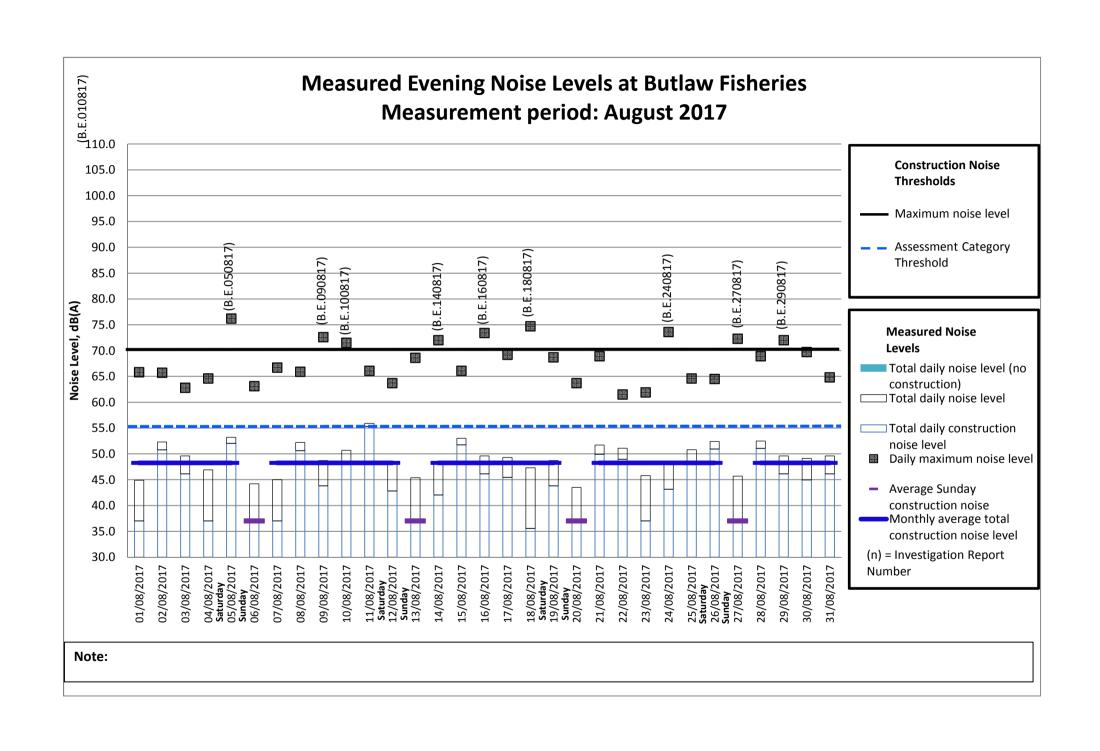


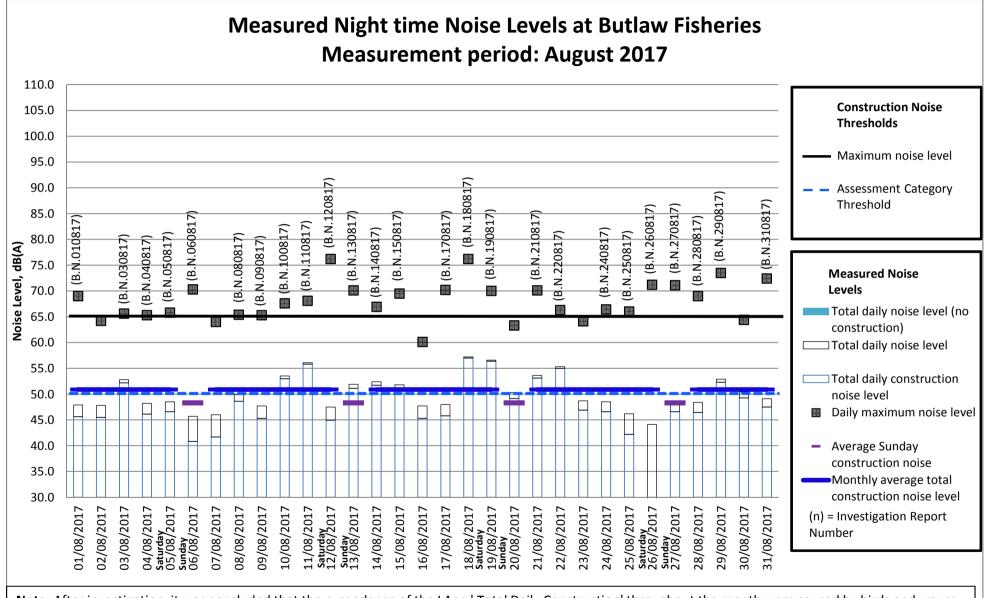



Note: After investigation, it was concluded that the exceedance of the LAeq 'Total Daily Construction' throughout the month were caused by birds and waves

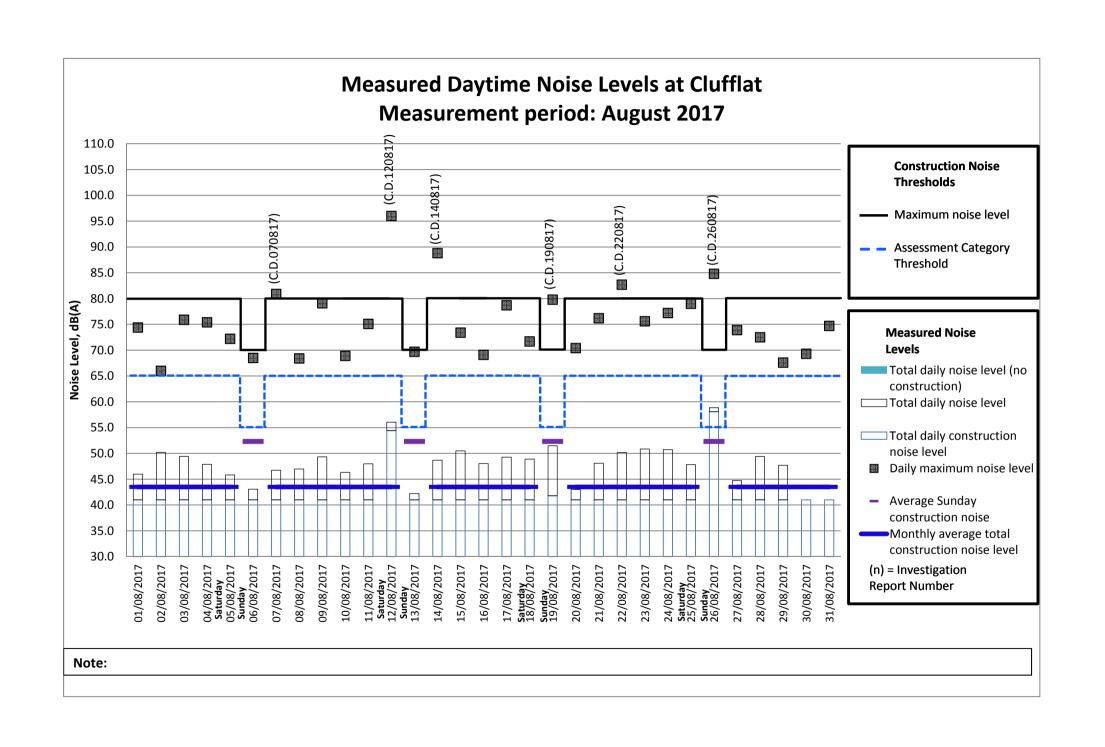


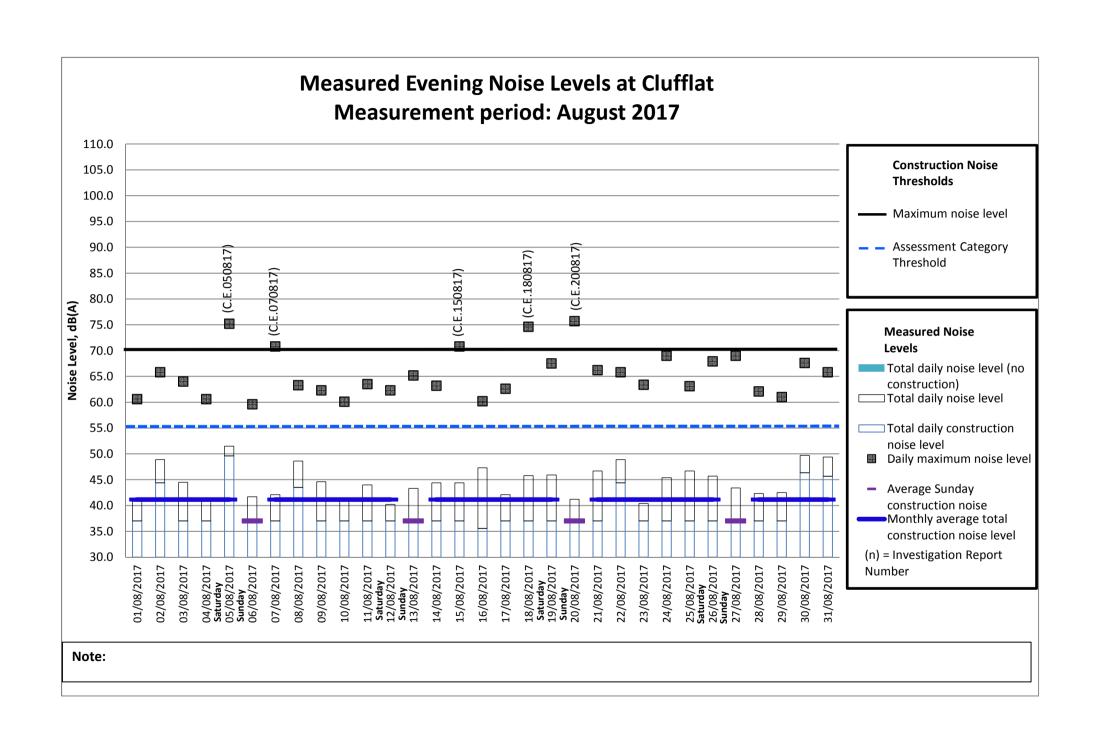


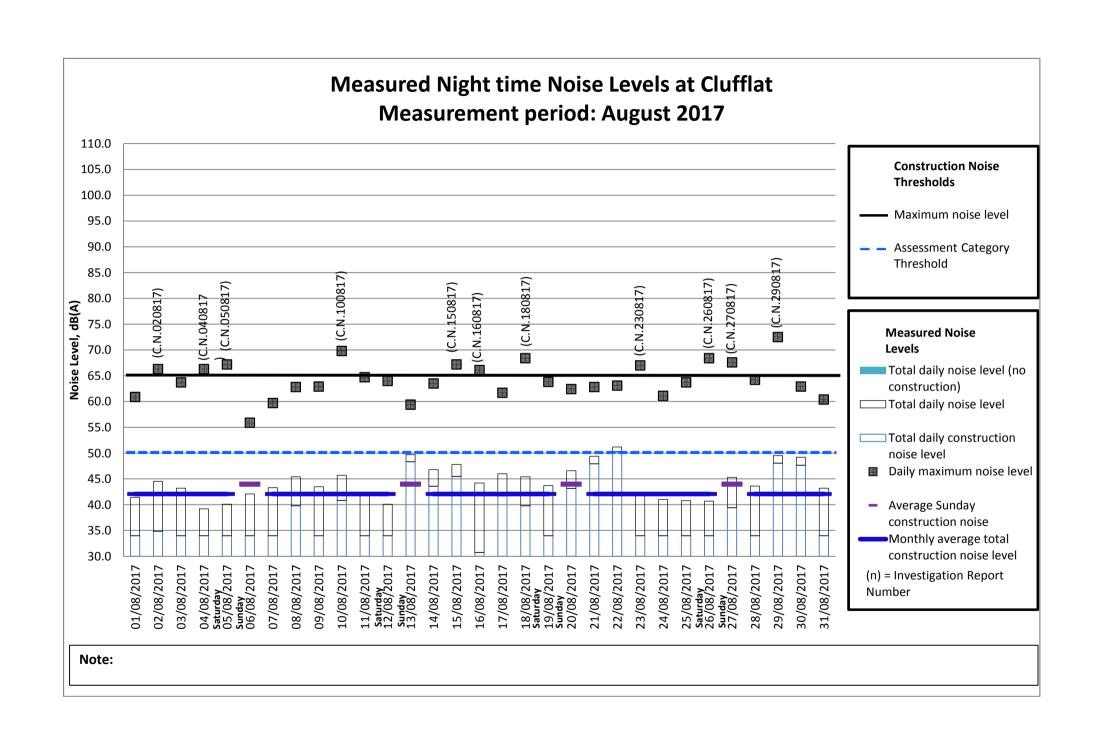


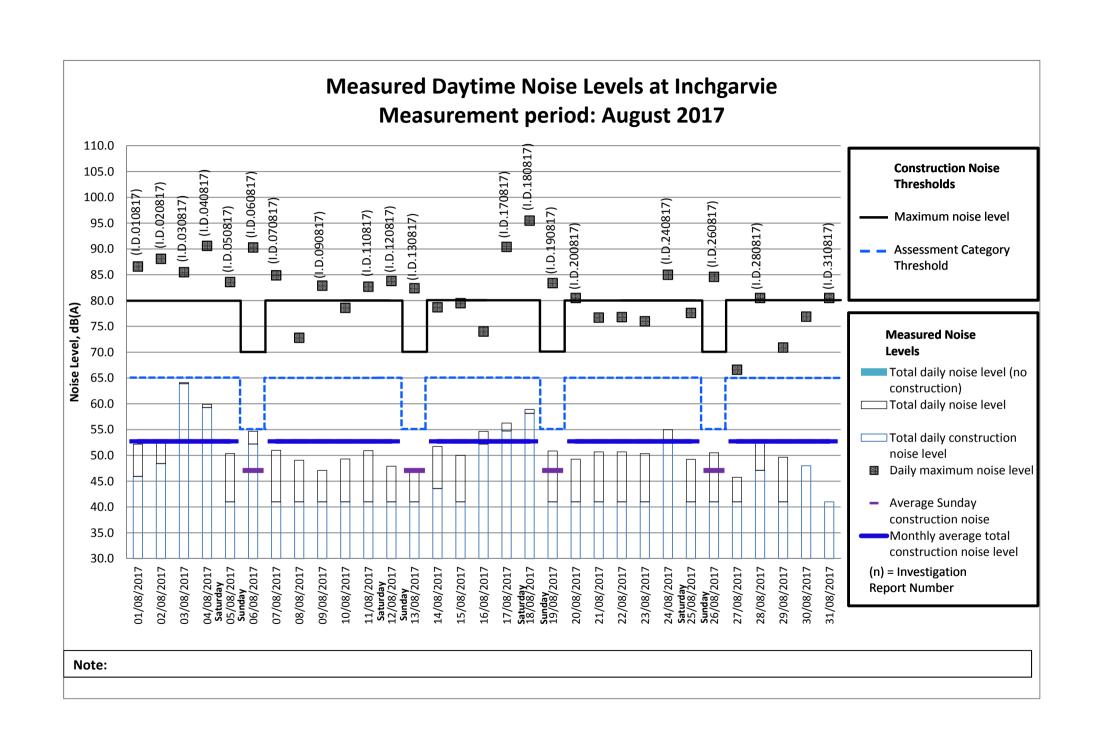


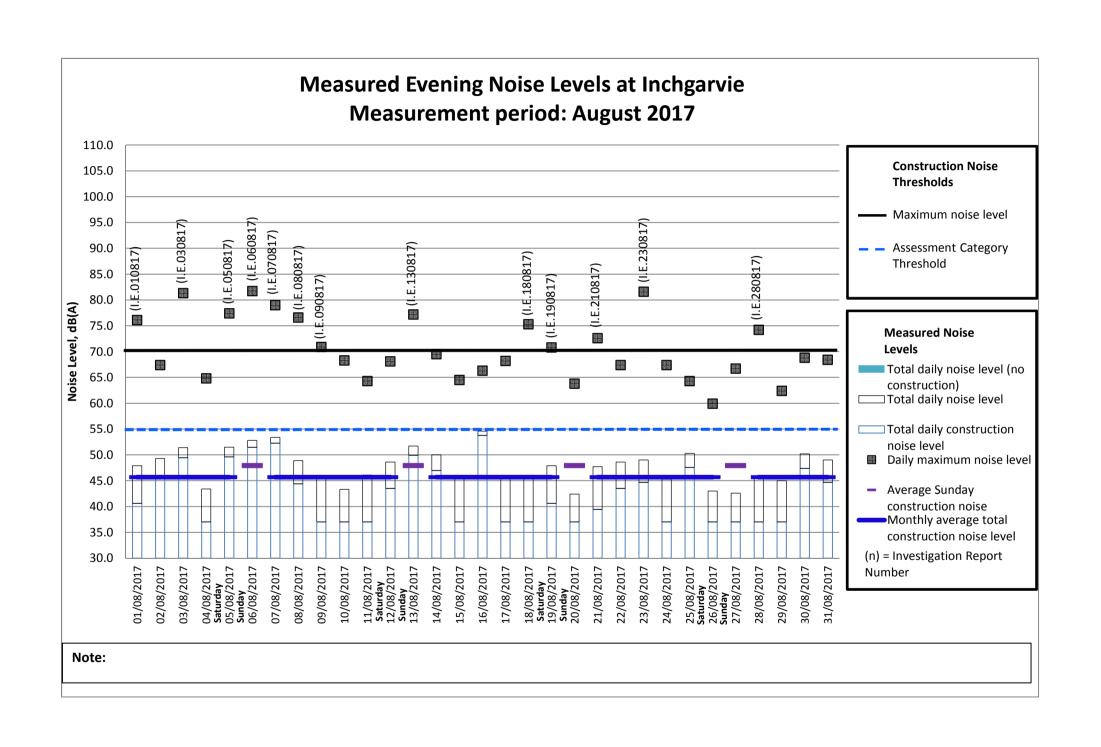


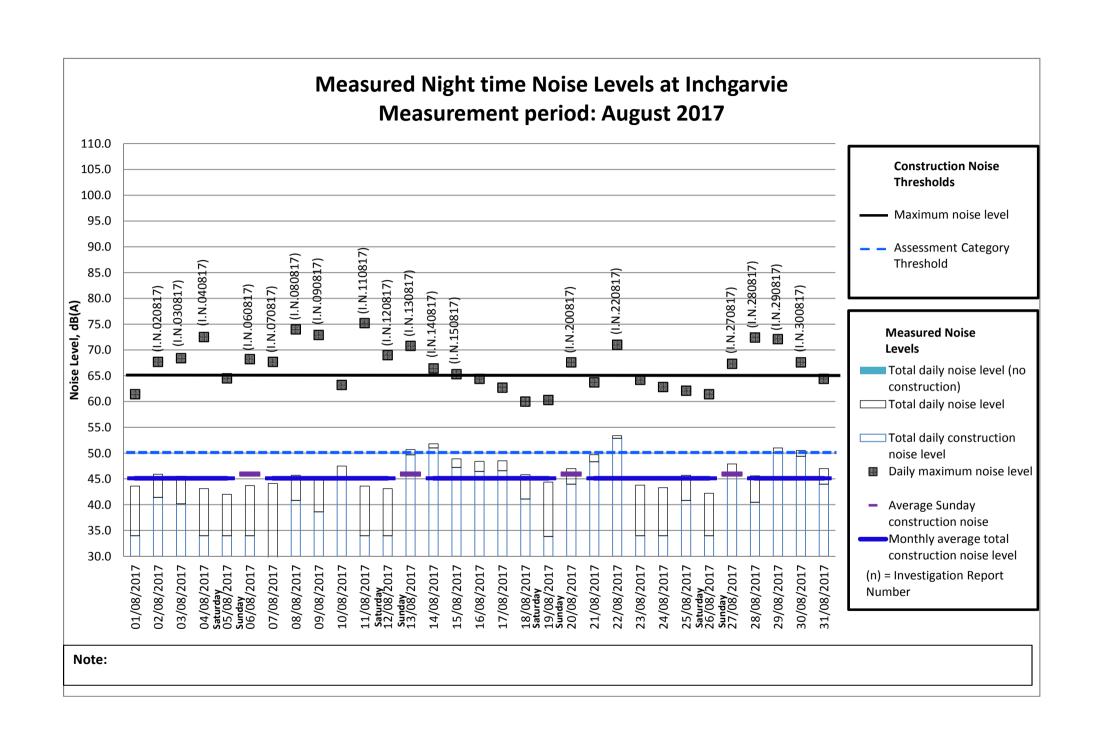


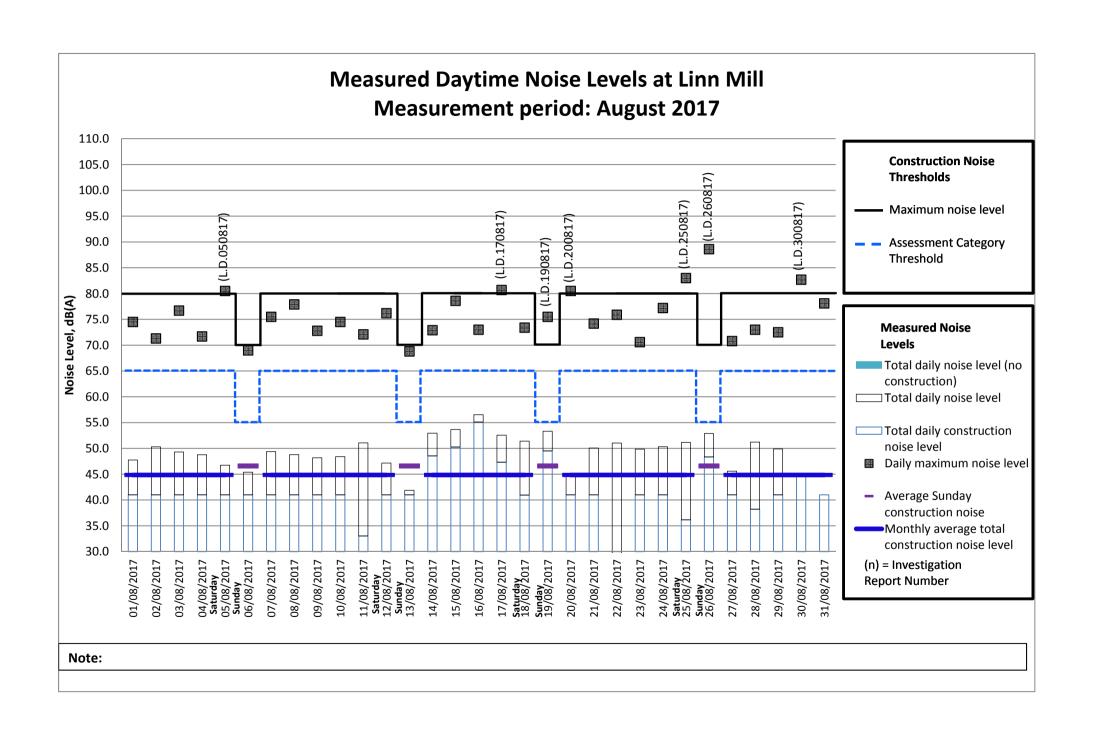


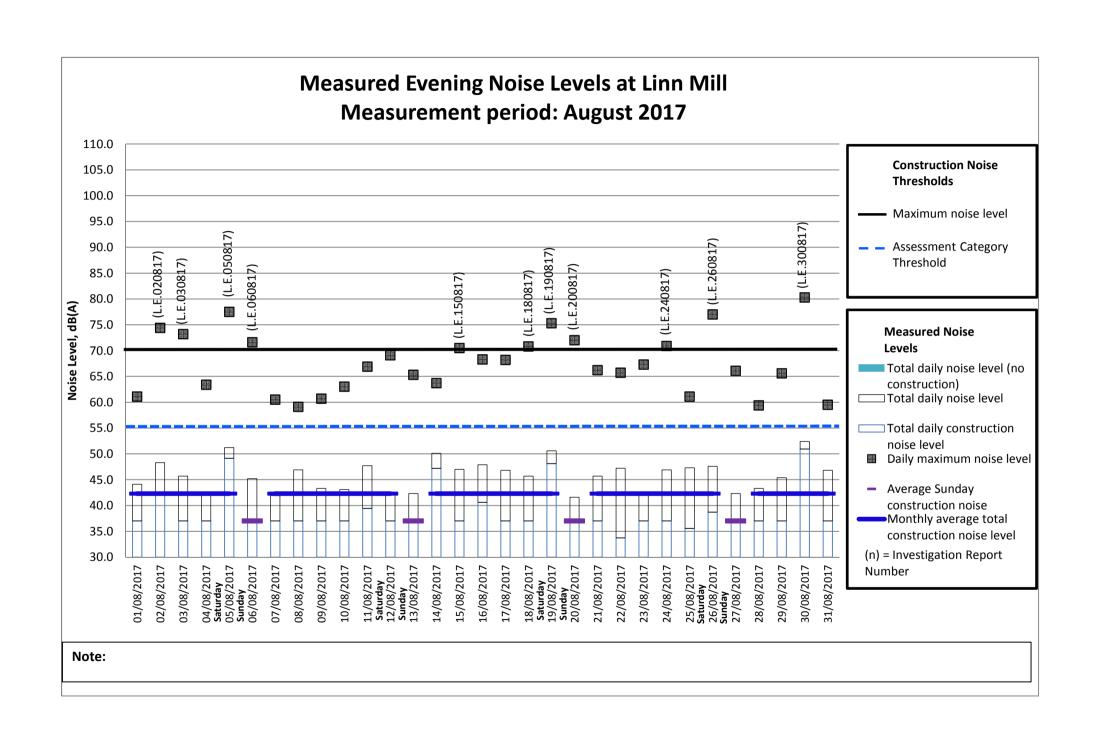

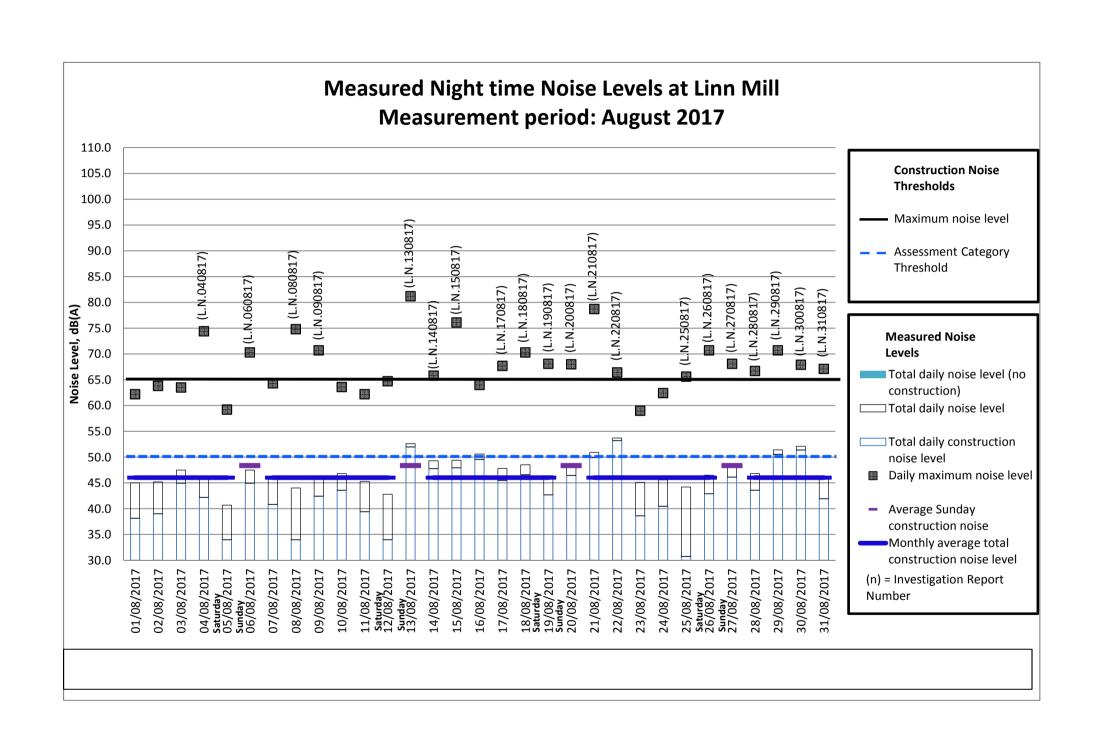


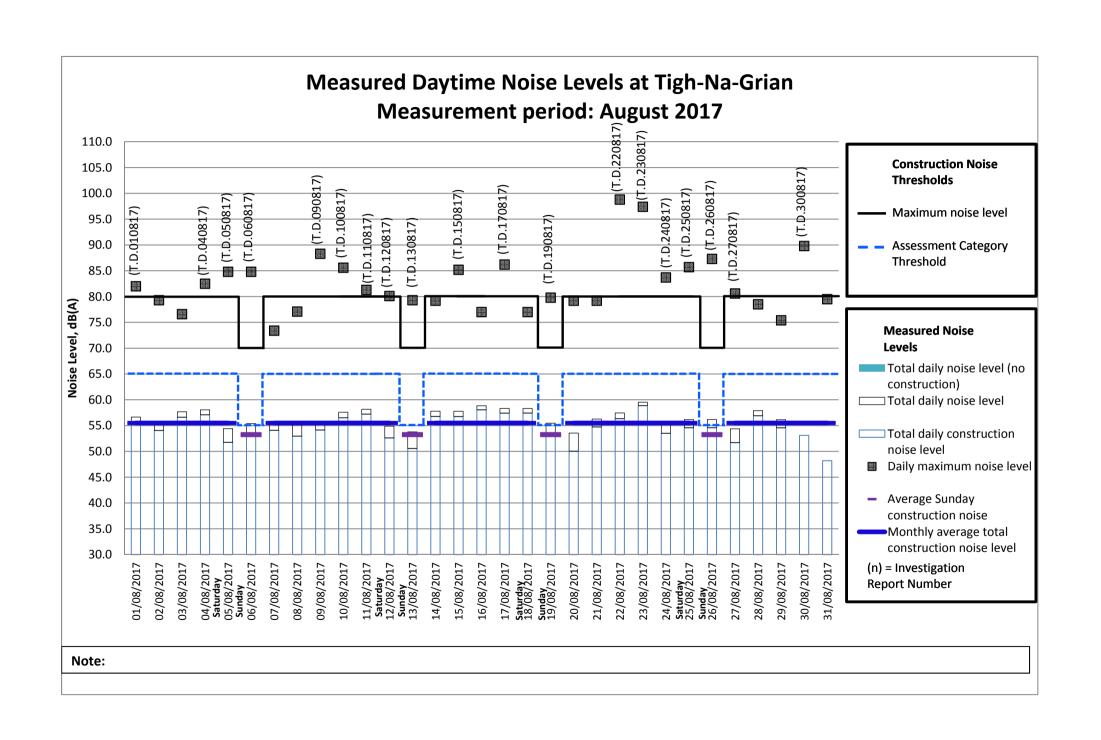

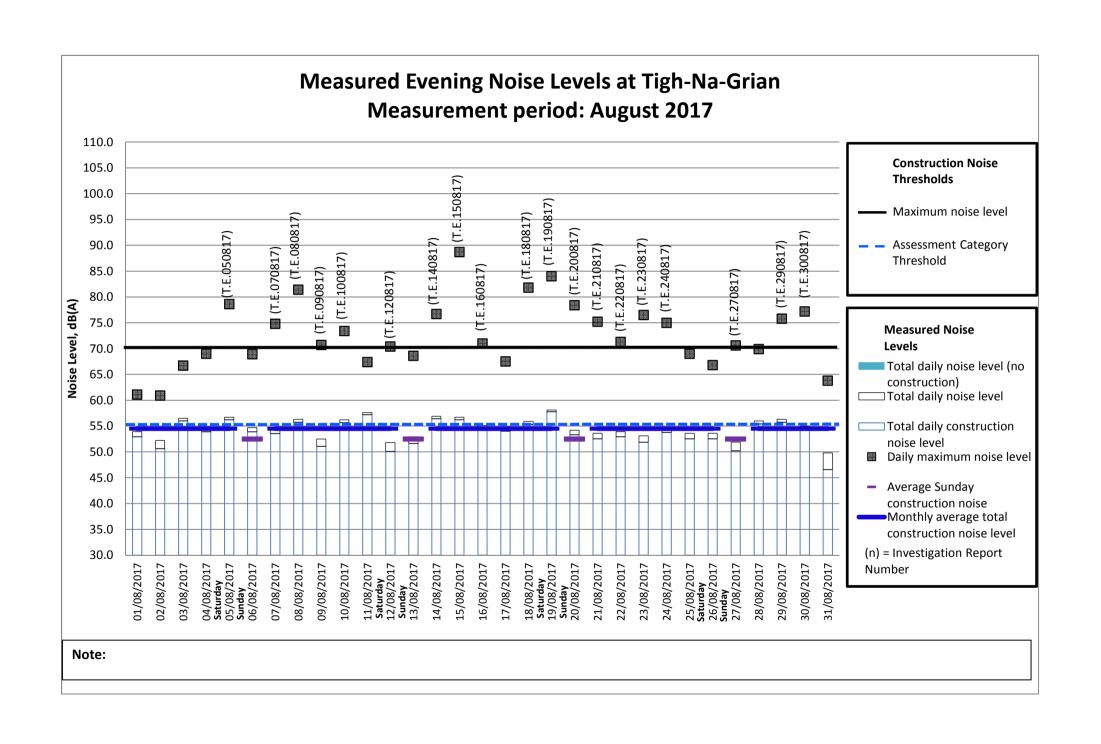


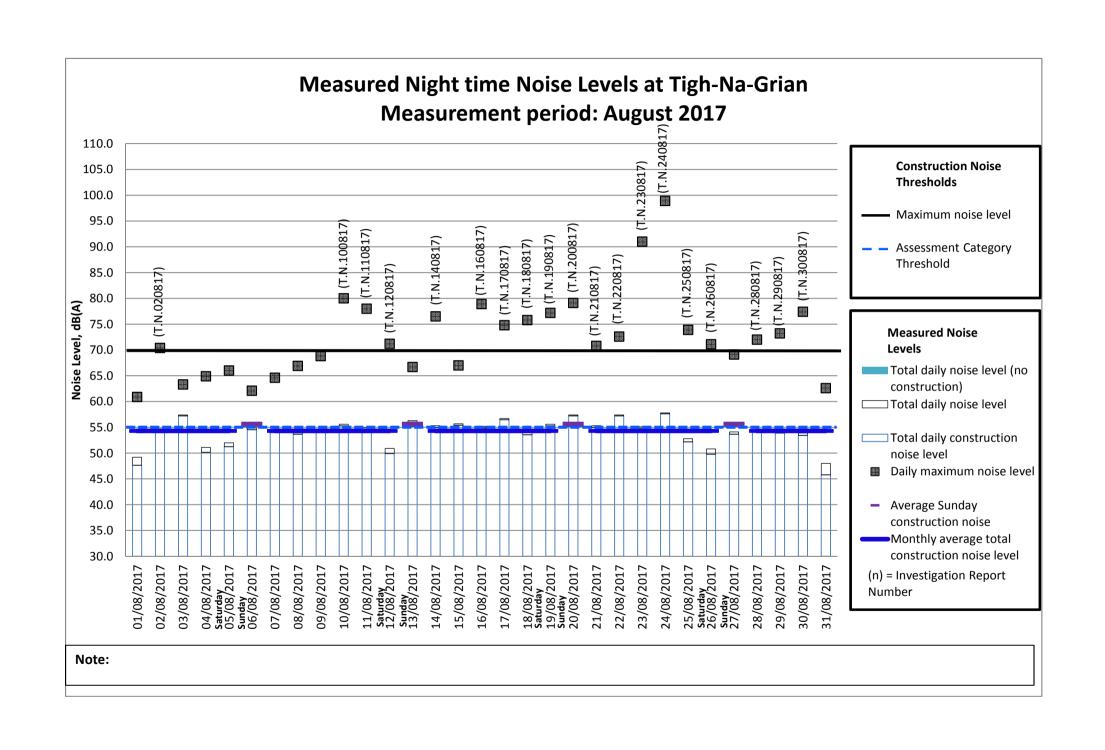





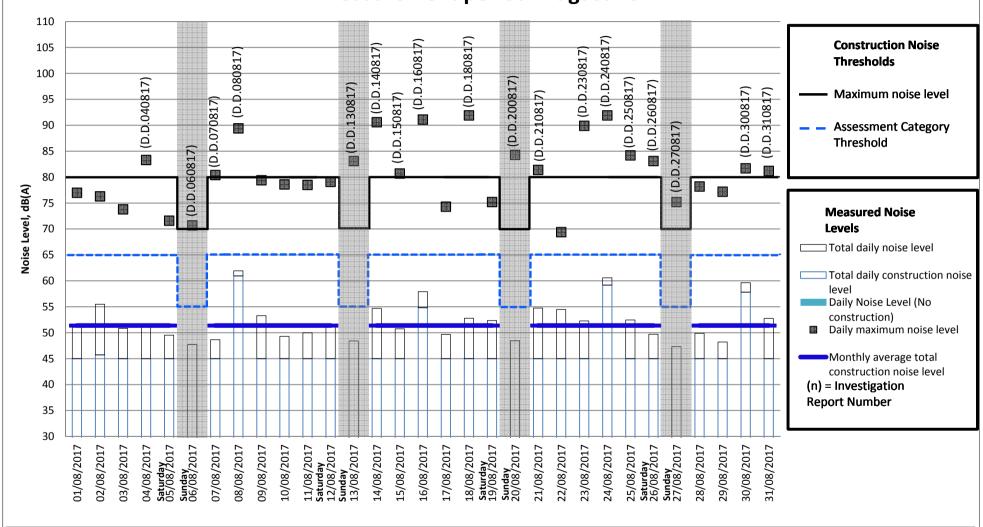



Note: The grey areas of the chart represent days on which no construction works have been conducted;

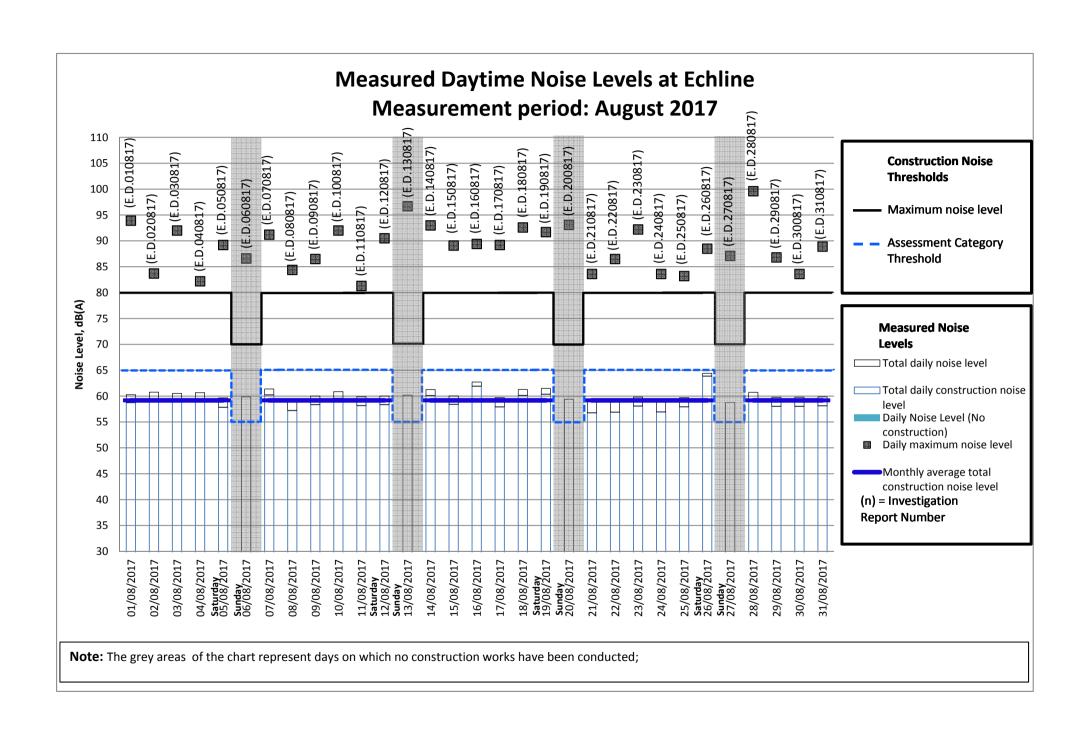

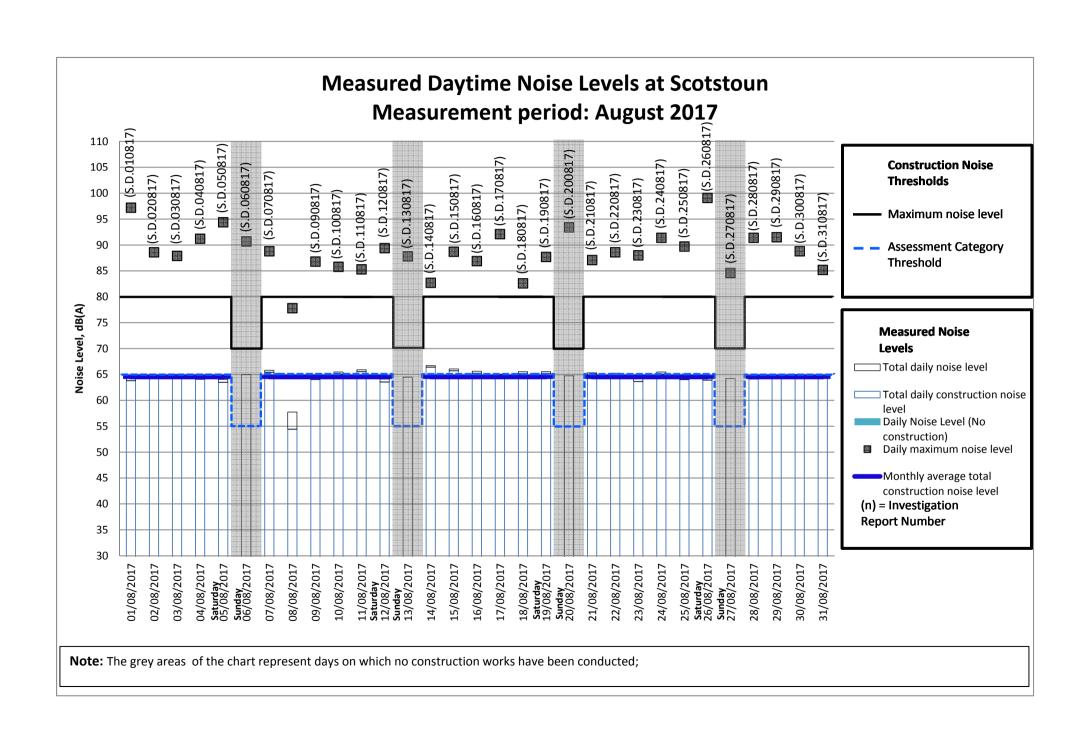

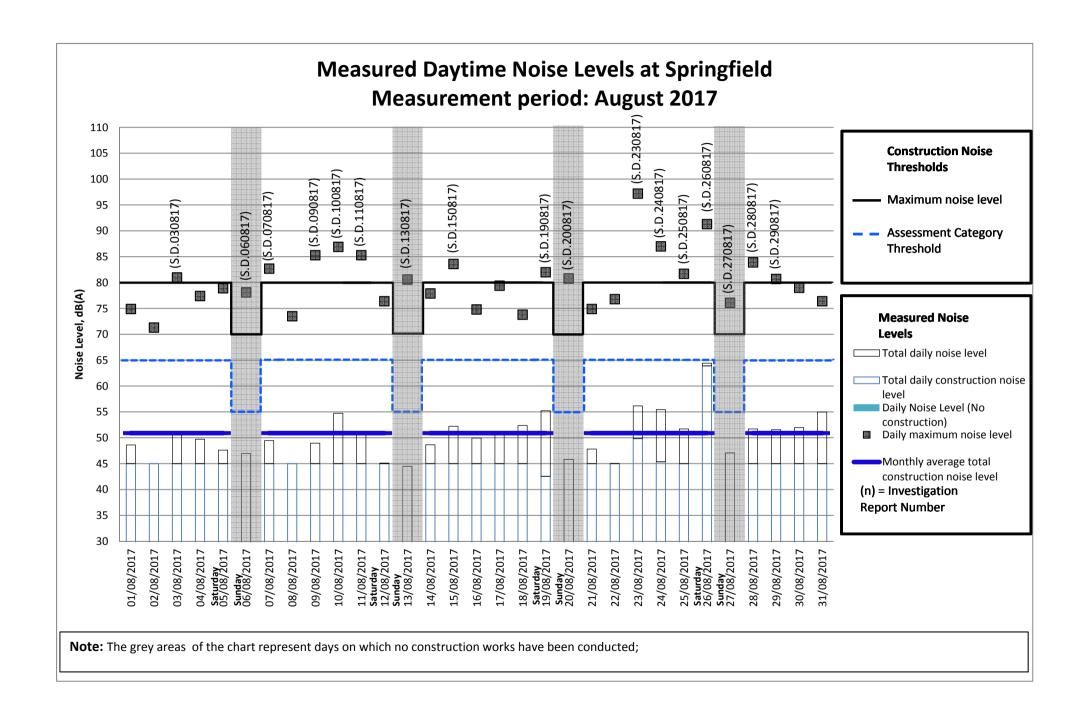



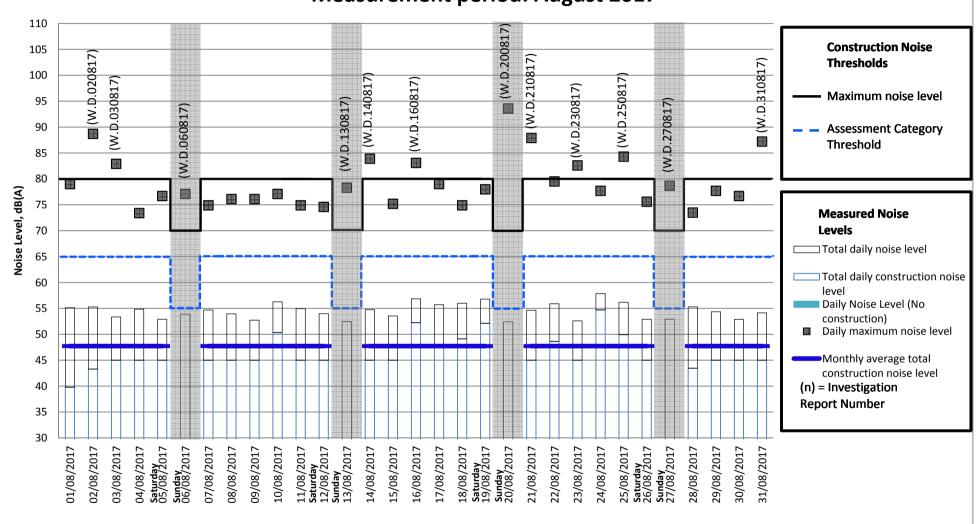

Note: The grey areas of the chart represent days on which no construction works have been conducted;